




Cable tacking Gun

Instruction Leaflet

RS stock no. 203-5121


Loading

Figure 1

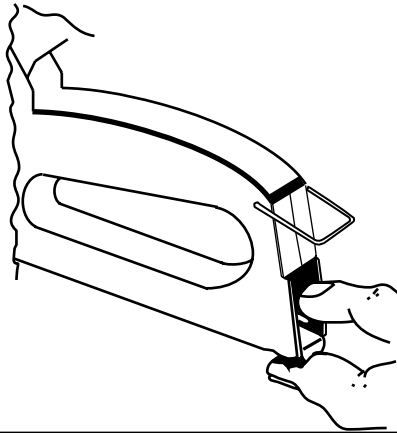

Squeeze and withdraw slide bar until stop is reached.

Figure 2

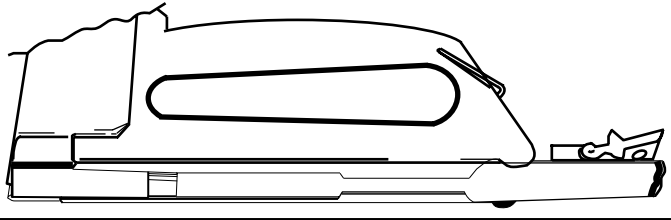

Load staples into underside of gun and close slide bar. The gun is now ready for use.

Maintenance

Do not lubricate: gun is supplied lubricated and requires no further lubrication.
Use only RS replacement staples (RS stock no. 390-230) for trouble free operation.

Caution: Do not use on mains cables

The information provided in **RS** technical literature is believed to be accurate and reliable; however, RS Components assumes no responsibility for inaccuracies or omissions, or for the use of this information, and all use of such information shall be entirely at the user's own risk.

No responsibility is assumed by RS Components for any infringements of patents or other rights of third parties which may result from its use.

Specifications shown in RS Components technical literature are subject to change without notice.

RS Components, PO Box 99, Corby, Northants, NN17 9RS Telephone: 01536 201234



An Electrocomponents Company

© RS Components 1997