


Ruland USSK40-32MM-28MM-F, 32mm x 28mm Single Universal Joint, Friction Bearing, Steel, Set Screw With Keyway, 63.4mm OD, 177.8mm Length

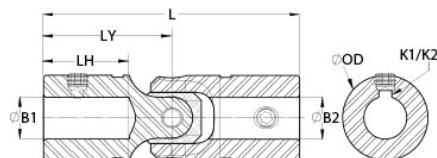

Ruland USSK40-32MM-28MM-F is a single cardan friction bearing universal joint with 32mm x 28mm bores, 10mm x 8mm keyways, 63.4mm OD, 177.8mm length, and 3/8-16 set screws. It is ideal for applications with space constraints and has higher torque capacity than equivalently sized double universal joints. This plain bearing universal joint is comprised of pins and blocks that are precision machined, selectively heat treated, and ground for high strength, accuracy, and wear resistance. The combination of these components with precision ground and hardened yoke ears allow for a longer lifespan, increased performance in demanding applications, and greater angular misalignment of up to 45° when compared to commodity style single universal joints. USSK40-32MM-28MM-F is made from high grade alloy steel for durability and high strength. It can be combined with boot UBOOT40/64-NI-KIT to protect the joint from unwanted contaminants such as dust or water and self lubricate reducing maintenance time. This single cardan universal joint is manufactured in the USA by Belden Universal for strict control of processes.

Bore (B1)	32 mm	Small Bore (B2)	28 mm
Keyway (K1)	10 mm	Keyway (K2)	8 mm
B1 Max Shaft Penetration	53.1 mm	B2 Max Shaft Penetration	53.1 mm
Joint Outer Diameter (OD)	63.4 mm	Bore Tolerance	+0.025 mm / -0.000 mm
Length (L)	177.8 mm	Yoke Length (LY)	88.9 mm
Hub Depth (LH)	53.1 mm	Broached Set Screw	3/8-16
Screw Finish	Black Oxide	Peak Torque	3615.5 Nm
Rated Torque	723.1 Nm	Max Operating Angle	45°
Material Specification	Alloy Steel	Manufacturer	Belden Universal
Country of Origin	USA	Recommended Lubricant	LUBRIPLATE No. 1200-2
Matching Boot Cover	UBOOT40/64-NI-KIT	UPC	63452934485
Tariff Code	8483.60.4000	UNSPC	25173810

Prop 65  **WARNING** This product can expose you to the chemical Ethylene Thiourea, known to the State of California to cause cancer and birth defects or other reproductive harm. For more information go to www.P65Warnings.ca.gov.