


170973 DFM-100-200-P-A-KF Guided drive - Series till 04-2023

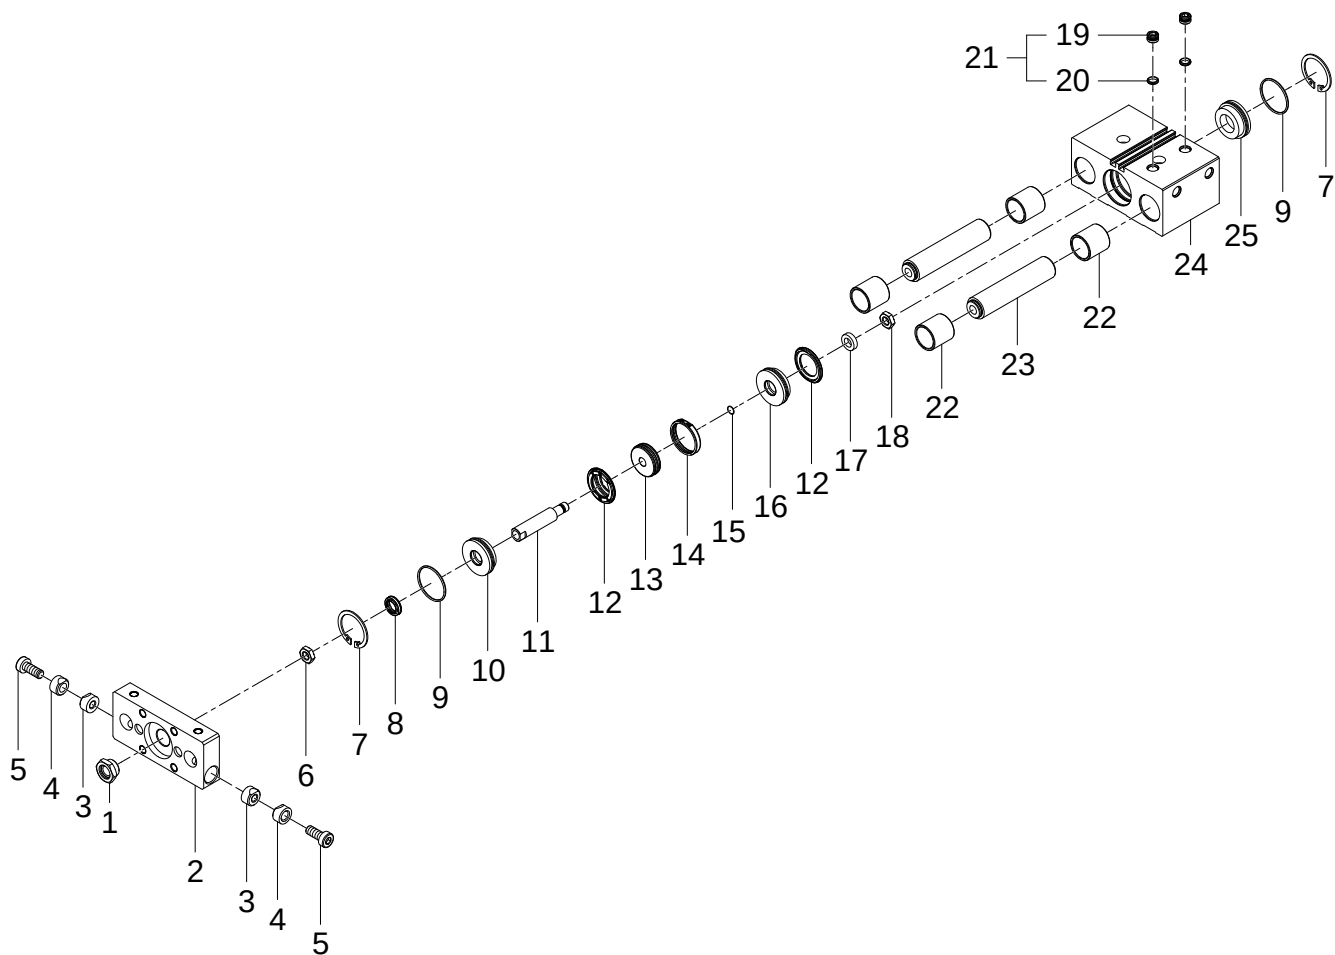

170973 DFM-100-200-P-A-KF Guided drive - Series till 04-2023

Pos.	Part no.	Type	Note	Qty.	Unit
A	394803	DFM-100-PA Set of wearing parts	Spare parts: 8, 9, 12, 15, 20 🔗 Replacing the wearing parts	1	PC
1		M20X1,5 Collar nut	Not available Position available until max. 06/15/2025! Use locking compound 8181256 CYBERBOND TM44 Tightening torque 110 Nm / 81.1 lbf ft	1	PC
2		DFM-100 End plate	Not available Position available until max. 06/15/2025!	1	PC
3	368292	M10 Clamping piece		2	PC
4	368291	M10 Clamping piece		2	PC
5	772284	ISO 4762-M10X25-8.8 Socket head screw	Use locking compound 8181256 CYBERBOND TM44 Tightening torque 40 Nm / 29.5 lbf ft	2	PC
6		M20X1,5-1.0715+C Hex nut	Not available Position available until max. 06/15/2025! Use locking compound 8181256 CYBERBOND TM44 Tightening torque 110 Nm / 81.1 lbf ft	1	PC
7	229760	DIN 472-102X4 Retaining ring		2	PC
8		WIFC1-25X30X4,6-TPE-U Wiper seal	Not available separately, see position A Lubricate with 684474 LUB-KC1 during assembly	1	PC
9		B-99X1,5-N-NBR70 O-ring ISO3601	Not available separately, see position A Lubricate with 684474 LUB-KC1 during assembly	2	PC
10	713459	DFM-100 Bearing cap		1	PC
11		ARA-25-S0219,0-S Piston rod	Not available Position available until max. 06/15/2025!	1	PC
12		DFM-100 Piston seal	Not available separately, see position A Lubricate with 684474 LUB-KC1 during assembly	2	PC
13		AEVU-100 Piston magnet	Not available	1	PC
14	338258	96,75X88X5,7 Ring magnet		1	PC
15		B-17X1,5-N-NBR70 O-ring ISO3601	Not available separately, see position A Lubricate with 684474 LUB-KC1 during assembly	1	PC
16		ADVU-100 Piston	Not available	1	PC
17	338341	18X36X6-1.0330 Disc		1	PC
18	213600	DIN 439-B-M16X1,5-A2-70 Hex nut	Use locking compound 8181256 CYBERBOND TM44 Tightening torque 45 Nm / 33.2 lbf ft	1	PC
19		G3/8A Plug screw	Not available separately, see position 21	2	PC
20		12,5X15,3X3,6 Sealing ring	Not available separately, see position 21+999 Lubricate with 684474 LUB-KC1 during assembly	2	PC
21	116517	G3/8 Plug screw		2	PC
22		30X40X50:LBBR30-2LS Ball bushing	Not available	4	PC
23		DFM-100-200-P-A-KF Guide rod	Not available Position available until max. 06/15/2025!	2	PC
24		DFM-100-200 Housing	Not available Lubricate with 684474 LUB-KC1 during assembly	1	PC
25		DFM-100-...-P-A End cap	Not available	1	PC