

## Installation Instructions for the Heavy Duty Pressure Transducers MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

**50010132**

Issue E

### GENERAL INFORMATION

Transducers with a gage (relative) reference are vented to the atmosphere through a case vent hole that is protected with a vapor inhibiting material.

### PRESSURE OVERLOADS

#### CAUTION PRODUCT DAMAGE

- Do not exceed the pressure overload rating.
- Failure to comply with these instructions may result in reduced life, or electrical failure.**

The MLH Series pressure transducers will withstand high overloads; however, if the overload rating is exceeded, the life of the MLH Series may be reduced and electrical failure may occur. Both static and dynamic overloads must be considered, particularly in hydraulic system applications. Hydraulic pressure fluctuations can have very high and very fast peak pressures, as in a water hammer effect.

An oscilloscope is recommended for determining if high pressure transients exist in a system. If system pressure pulses are expected, choose a transducer with a pressure rating high enough to allow continuous operation at the highest expected pressure spikes.

A pressure 'snubber' may be used to reduce the peak pressure applied to the transducer.

### MEDIA COMPATIBILITY

#### CAUTION PRODUCT DAMAGE

- Use non-abrasive, chemically compatible media to prevent damage to the diaphragm or pressure port materials.
- Failure to comply with these instructions may result in product failure.**

The MLH Series diaphragm and pressure port is an assembly of Haynes 214 alloy and 304L stainless steel.

### INSTALLATION

#### CAUTION PRODUCT DAMAGE

- Use a hex wrench for installation. Never apply torque to the connector housing or the body of the transducer.
  - Do not subject the transducer to high temperatures from soldering, brazing, or welding of the system plumbing or operating environments above the specified maximum temperature.
- Failure to comply with these instructions may result in product damage.**

Ratiometric voltage devices require a regulated 5.0 Vdc supply. All other versions can use an unregulated supply within the ranges noted under the excitation specifications. The power supply should be off while wiring.

### ELECTROMAGNETIC ENERGY/NOISE

#### CAUTION PRODUCT DAMAGE/ERRATIC OPERATION

- Do not use in areas where electromagnetic energy may affect transducer operation.
- Failure to comply with these instructions may result in improper operation and/or product failure.**

The MLH Series has been rated for high immunity to electrical noise; however, care should be taken when used around high voltage sources that emit high levels of radiated electromagnetic energy like variable frequency motor drives, solenoids, radio transmitters and engine ignition systems. The use of shielded cable and grounding of pressure port is also recommended.

### BENCH TEST

For incoming inspection or transducer failure evaluation:

1. Connect the transducer to a dc voltage supply (off).
2. Set the supply voltage to within the range specified for the model.
3. Based on the transducer's specified output, connect the output lead(s) to a digital dc or mA meter.
4. With no pressure on the transducer, turn on the power supply and read the output signal on the voltmeter. The reading should correspond to the specification indicated for null offset. If not, check the connections, wire color code and the setting of the power supply.

### WIRING INSTRUCTIONS

The wiring code for electrical connection is shown in Figure 3.

When using a connector, the use of the correct size wire is important to ensure environmental sealing. Fill all holes in the connector seal even if only two leads are used. Honeywell recommends using a crimping tool for crimping wires to the connector pins. Contact the individual connector manufacturer for mating connector wiring.

# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

Issue E

**50010132**

**Table 1. Pressure Range Specifications<sup>1</sup> (At 25°C [77°F] and at rated excitation unless otherwise specified.)**

bar			psi		
Operating Pressure	Proof Pressure	Burst Pressure	Operating Pressure	Proof Pressure	Burst Pressure <sup>2</sup>
6	18	60	50	150	500
10	30	100	100	300	1000
16	48	160	150	450	1500
25	75	250	200	600	2000
40	80	400	250	750	2500
60	120	600	300	900	3000
100	200	1000	500	1500	5000
160	320	1600	1000	2000	10000
250	500	2068	2000	4000	20000
350	700	2068	3000	6000	30000
500	750	2068	5000	7500	30000
550	825	2068	8000	12000	30000

<sup>1</sup> Comparable metric units follow same proof and burst specifications.

<sup>2</sup> Bonded washer seal used on G 1/8 (DIN 3852-2) port is limited to 25000 psi burst.

**Table 2. Electrical Specifications (At 25°C [77°F] unless otherwise noted.)**

Characteristic	Output Signal					
	Ratiometric A	Current B	Regulated C	Regulated D	Regulated E	Regulated G
Zero output	0.5 Vdc	4 mA	1 Vdc	0.25 Vdc	0.5 Vdc	1 Vdc
Full scale span (FSS)	4 Vdc (0.5 Vdc to 4.5 Vdc)	16 mA (4 mA to 20 mA)	5 Vdc (1 Vdc to 6 Vdc)	10 Vdc (0.25 Vdc to 10.25 Vdc)	4 Vdc (0.5 Vdc to 4.5 Vdc)	4 Vdc (1 Vdc to 5 Vdc)
Excitation	5 Vdc (6 Vdc max.) <sup>1</sup>	9.5 Vdc to 30 Vdc <sup>2</sup>	8 Vdc to 30 Vdc <sup>2</sup>	14 Vdc to 30 Vdc <sup>2</sup>	7 Vdc to 30 Vdc <sup>2</sup>	8 Vdc to 30 Vdc <sup>2</sup>
Supply current	4 mA typ., 8 mA max.	N/A	5 mA typ., 17 mA max.	5 mA typ., 17 mA max.	5 mA typ., 17 mA max.	5 mA typ., 17 mA max.
Source (nominal)	1 mA	N/A	1 mA	1 mA	1 mA	1 mA
Sink (nominal)	1 mA at zero output	N/A	1 mA at zero output	1 mA at zero output	1 mA at zero output	1 mA at zero output
Supply rejection ratio	90 dB	90 dB	90 dB	90 dB	90 dB	90 dB
Output impedance	25 Ohm max.	N/A	25 Ohm max.	25 Ohm max.	25 Ohm max.	25 Ohm max.

<sup>1</sup> Maintains ratiometricity at 5 ±0.25 Vdc excitation. Product can tolerate 6 Vdc excitation without damage.

<sup>2</sup> See Figures 1 and 2 for more information regarding maximum excitation voltage vs. operating temperature.

**Table 3. Pressure Reference Types**

Pressure Reference	Description
Sealed gage <sup>1</sup>	Output is proportional to the difference between applied pressure and a built-in fixed reference to 1 atmA, where the minimum operating pressure is set to 14.7 psiA (1 atmA).
Vented gage (relative) <sup>2</sup>	Transducer measures pressure relative to ambient pressure. Output is proportional to the difference between applied pressure and atmospheric (ambient) pressure, where the minimum operating pressure is set to atmospheric pressure.

# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

Issue E

**50010132**

**Table 4. Environmental and Mechanical Specifications (At 25°C [77°F] unless otherwise noted.)**

Characteristic	Parameter
Material in contact with media: port diaphragm	stainless steel 304L Haynes 214 alloy
Housing material	black plastic – Amodel AS-4133 HS – PPA
Weight (typical for Metri-Pack 150 and 1/8 NPT pressure port types)	57.0 g [2.0 oz]
Shock	100 g peak [11 ms]
Vibration	MIL-STD-810C, Figure 514.2-5, Curve AK, Table 514.2-V, Random Vibration Test (overall g rms = 20.7 min.)
Compensated and operating temperature range: 0.5 Vdc to 4.5 Vdc ratiometric output all regulated and 4 mA to 20 mA outputs	-40°C to 125°C [-40°F to 257°F] -40°C to 125°C [-40°F to 257°F] (See Figures 1 and 2 for operating area details.)
Storage temperature range	-40°C to 125°C [-40°F to 257°F]
Approvals	RoHS, CE, UL Component Recognition for USA and Canada: File No. E258956

**Table 5. Performance Specifications (At 25°C [77°F] unless otherwise noted.)**

Characteristic	Parameter
Response time	<2 ms
Accuracy <sup>1</sup> : ≥100 psi ≤100 psi	±0.25 %FSS ±0.50 %FSS
Total Error Band <sup>2</sup> : Vented gage (relative): <300 psig ≥300 psig Sealed gage: <u>without L, M, P</u> electrical connector types: 100 psis to 299 psis (-40°C to 85°C [-40°F to 185°F]) 100 psis to 299 psis (>85°C to 125°C [>185°F to 257°F]) ≥300 psis (-40°C to 125°C [-40°F to 257°F]) <u>with L, M, P</u> electrical connector types: 100 psis to 299 psis (-40°C to 65°C [-40°F to 149°F]) 100 psis to 299 psis (>65°C to 125°C [>149°F to 257°F]) ≥300 psis (-40°C to 65°C [-40°F to 149°F]) ≥300 psis (>65°C to 125°C [>149°F to 257°F])	±3 %FSS ±2 %FSS  ±3 %FSS ±10 %FSS ±2 %FSS  ±10 %FSS ±15 %FSS ±5 %FSS ±15 %FSS

<sup>1</sup>Includes pressure non-linearity (BFSL), pressure hysteresis and pressure non-repeatability. Thermal errors are not included.


<sup>2</sup>Includes offset error, full scale span error, pressure non-linearity (BFSL), pressure hysteresis, pressure non-repeatability, thermal effect on offset, thermal effect on span, and thermal hysteresis.

# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi


Issue E  
**50010132**

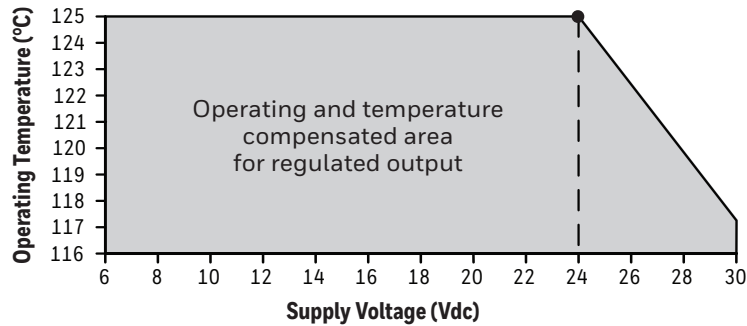**Figure 1. Regulated Output Operating and Temperature Compensation**



Note: The dot indicates the maximum operating temperature of 125°C [257°F] with a 24 V supply.

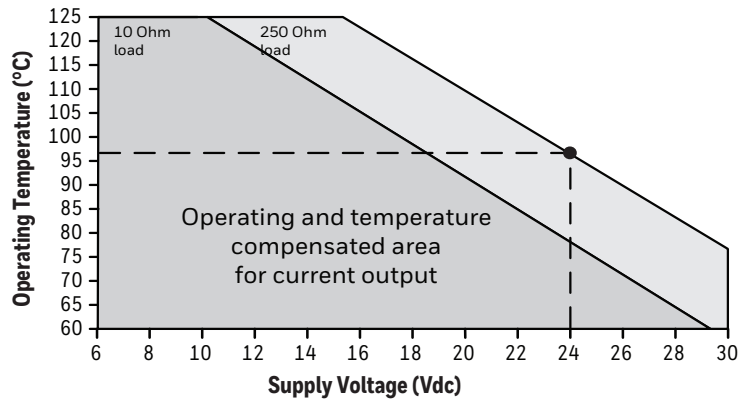**Figure 2. Current Output Operating and Temperature Compensation**



Note: The operating area is extended with a 250 Ohm resistor. Higher loads extend the operating area. The dot indicates the maximum operating temperature when using a 24 V supply and a 250 Ohm resistor.

## CAUTION

### PRODUCT DAMAGE DUE TO MECHANICAL ISSUES

- Ensure torque specifications are determined for the specific application. Values provided are for reference only. (Mating materials and thread sealants can result in significantly different torque values from one application to the next.)
- When using mating parts made of stainless steel, use a thread sealant with anti-seize properties to prevent thread galling. Ensure the sealant is rated for the application.
- Use appropriate tools (such as an open ended wrench or deep well socket) to install transducers.
- Always hand-start transducers into the hole to prevent cross threading and damage.
- Ensure that torque is not applied to the electrical connector.
- Ensure that the proper mating electrical connector with a seal is used to connect the transducer. Improper or damaged seals can compromise ingress protection, leading to short circuits.

**Failure to comply with these instructions may result in product damage.**

## CAUTION

### PRODUCT DAMAGE DUE TO PARTICULATES

- Ensure that a filter is used upstream of the transducer to keep media flow free of larger particulates and increased humidity. All MLH Series transducers are dead-ended devices; particulate accumulation and condensing moisture may affect transducer output.
- It is recommend that the transducer be positioned with the port facing downwards; any particulates in the system are less likely to enter and settle within the pressure transducer if it is in this position.
- Ensure that the media does not create a residue when dried. Build-up inside the transducer may affect transducer output; rinsing of a dead-ended transducer is potentially difficult and has limited effectiveness in removing residue.

**Failure to comply with these instructions may result in product damage.**


# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi


Issue E

50010132

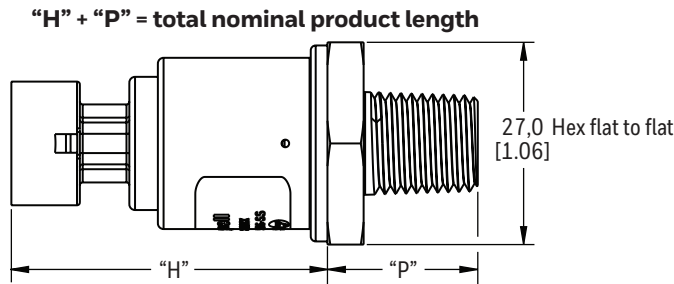Figure 3. Electrical Connector Type Mounting Dimensions (For reference only. mm/[in].)



General product marking

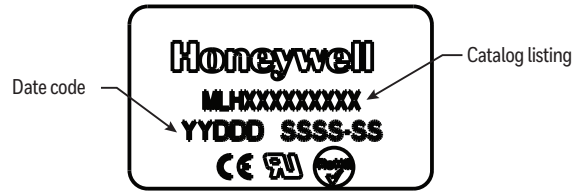

B Metri-Pack 150			C Hirschmann			D M12x1 (Brad Harrison micro)			G DIN 43650-C, 8 mm male		
<b>Connector:</b> Delphi 12078088 <b>Mating connector:</b> Delphi 12110192 <b>IP rating<sup>1</sup>:</b> IP65 (all versions)			<b>Connector:</b> Hirschmann G series, 4-pole (small cubic connector) <b>Mating connector:</b> Hirschman G4WF or equivalent <b>IP rating<sup>1</sup>:</b> IP65 (all versions)			<b>Connector:</b> DS/EN 61076-2-101 (IEC 61076-2-101) <b>Mating connector:</b> 4 POS Type D <b>IP rating<sup>1</sup>:</b> IP65, IP67 (sealed gage versions), IP65 (vented gage versions)			<b>Connector:</b> DIN 43650C, 8 mm <b>Mating connector:</b> DIN 43650C, 8 mm <b>IP rating<sup>1</sup>:</b> IP65 (all versions)		
Pin	Voltage Output (3-wire)	Current Output (2-wire)	Pin	Voltage Output (3-wire)	Current Output (2-wire)	Pin	Voltage Output (3-wire)	Current Output (2-wire)	Pin	Voltage Output (3-wire)	Current Output (2-wire)
A	+excitation	+excitation	1	no connection	no connection	1	+excitation	+excitation	1	+excitation	+excitation
B	common	no connection	2	output	no connection	2	common	-excitation (return)	2	common	-excitation (return)
C	output	-excitation (return)	3	common	-excitation (return)	3	output	no connection	3	no connection	no connection
			4	+excitation	+excitation	4	no connection	no connection	4	output	no connection
<p>"H" = 41,7 [1.64]</p>			<p>"H" = 32,6 [1.28]</p>			<p>"H" = 33,5 [1.32]</p>			<p>"H" = 30,1 [1.19]</p>		





# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

Issue E

50010132

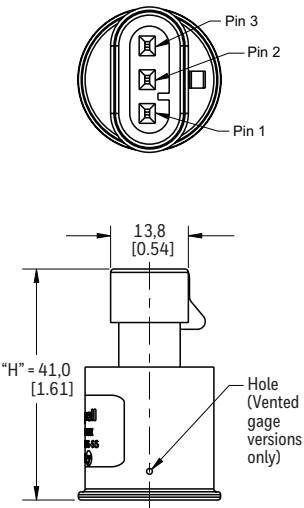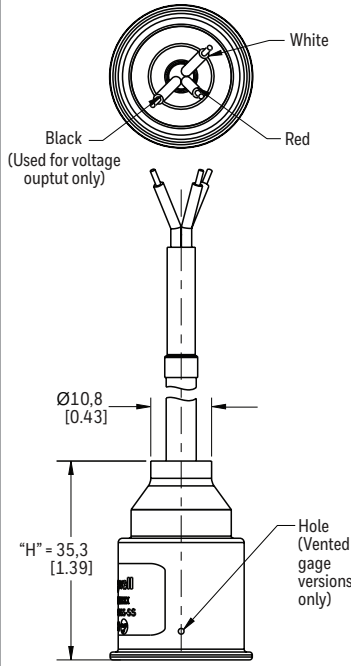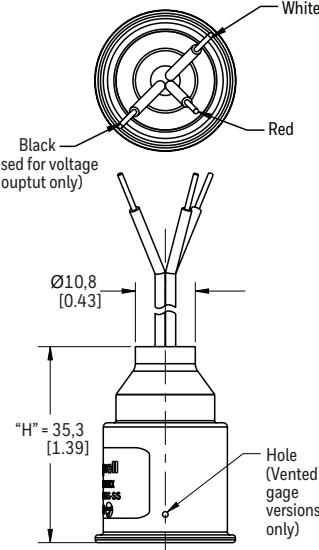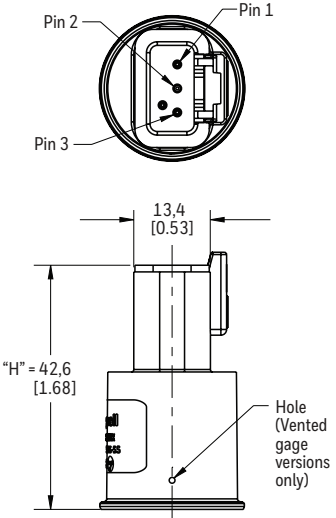Figure 3. Electrical Connector Type Mounting Dimensions (continued)

H AMP Superseal 1.5		L Cable Harness, 1 Meter M Cable Harness, 3 Meter			P Flying Leads			T Deutsch DTM04-3P (integral)		
<b>Connector:</b> Amp 282087 <b>Mating connector:</b> Amp 282087 <b>IP rating<sup>1</sup>:</b> IP65 (all versions)		<b>Connector:</b> 24 AWG with TPE jacket <b>Mating connector:</b> Flying leads <b>IP rating<sup>1</sup>:</b> IP65, IP67, IP69K (sealed gage versions), IP65 (vented gage versions)			<b>Connector:</b> 6 in flying leads with 20 AWG wire and PE insulation <b>IP rating<sup>1</sup>:</b> IP65, IP67, IP69K (sealed gage versions), IP65 (vented gage versions)			<b>Connector:</b> DTM04-3P <b>Mating connector:</b> DTM06-3S with wedgelock WM-3S <b>IP rating<sup>1</sup>:</b> IP65, IP67, IP69K (sealed gage versions), IP65 (vented gage versions)		
Pin	Voltage Output (3-wire)	Wire Color	Voltage Output (3-wire)	Current Output (2-wire)	Wire Color	Voltage Output (3-wire)	Current Output (2-wire)	Pin	Voltage Output (3-wire)	Current Output (2-wire)
1	common	red	+excitation	+excitation	red	+excitation	+excitation	1	+excitation	+excitation
2	output	white	output	-excitation (return)	white	common	-excitation (return)	2	common	-excitation (return)
3	+excitation	black	common	no connection (black wire removed)	black	output	no connection (black wire removed)	3	output	no connection
										

<sup>1</sup> IP rating is determined by the electrical connector type chosen.

<sup>2</sup> Three-wire cable is required for ratiometric and regulated voltage outputs; two wire cable is required for current output.


# Heavy Duty Pressure Transducers

Issue E


MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

50010132

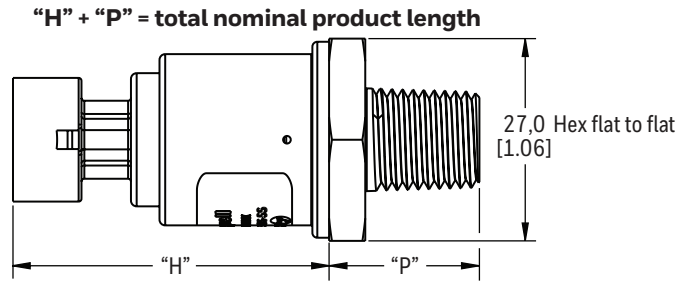Figure 4. Pressure Port Type Mounting Dimensions (For reference only: mm/[in].)<sup>1</sup>



General product marking

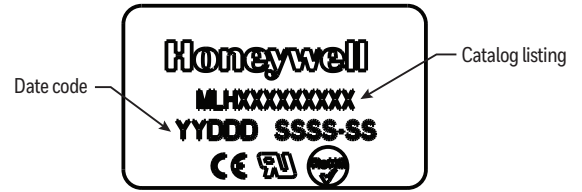

<p><b>01</b> 1/4-18 NPT</p>	<p><b>06</b> 1/8-27 NPT</p>	<p><b>09</b> 7/16-20 UNF 1/4 in 45° Flare Female Schrader with depressor</p>
<p><b>Seal:</b> Pipe thread <b>Mating geometry:</b> ANSI B1.20.1-2013 <b>Installation torque:</b> 2 to 3 turns from finger tight</p> <p>"P" = 20,1 [0.79] 15,2 [0.60]</p>	<p><b>Seal:</b> Pipe thread <b>Mating geometry:</b> ANSI B1.20.1-2013 <b>Installation torque:</b> 2 to 3 turns from finger tight</p> <p>"P" = 15,0 [0.59] 10,2 [0.40]</p>	<p><b>Seal:</b> 45° cone <b>Mating geometry:</b> SAE J512 <b>Installation torque:</b> 20 Nm [14.8 ft-lb]</p> <p>"P" = 17,5 [0.69] 12,7 [0.50]</p>
<p><b>11</b> 1/2-14 NPT</p>	<p><b>13</b> R1/4-19 (BSPT)</p>	<p><b>19</b> R1/8-28 (BSPT)</p>
<p><b>Seal:</b> Pipe thread <b>Mating geometry:</b> ANSI B1.20.1-2013 <b>Installation Torque:</b> 2 to 3 turns from finger tight</p> <p>"P" = 24,9 [0.98] 20,1 [0.79]</p>	<p><b>Seal:</b> Pipe thread <b>Mating geometry:</b> ISO 7-1 <b>Installation Torque:</b> 2 to 3 turns from finger tight</p> <p>"P" = 19,6 [0.77] 14,7 [0.58]</p>	<p><b>Seal:</b> Pipe thread <b>Mating geometry:</b> ISO 7-1 <b>Installation Torque:</b> 2 to 3 turns from finger tight</p> <p>"P" = 15,0 [0.59] 10,2 [0.40]</p>
<p><b>50</b> 3/8-24 UNF (SAE J1926-2)</p>	<p><b>51</b> 7/16-20 UNF (SAE J1926-2)</p>	<p><b>52</b> 1/2-20 UNF (SAE J1926-2)</p>
<p><b>Seal:</b> O-ring <b>Mating geometry:</b> SAE J1926-1 <b>Installation torque:</b> 10 N m [7.4 ft-lb]</p> <p>"P" = 18,3 [0.72] 13,5 [0.53]</p>	<p><b>Seal:</b> O-ring <b>Mating geometry:</b> SAE J1926-1 <b>Installation torque:</b> 20 N m [14.8 ft-lb]</p> <p>"P" = 19,8 [0.78] 15,0 [0.59]</p>	<p><b>Seal:</b> O-ring <b>Mating geometry:</b> SAE J1926-1 <b>Installation torque:</b> 40 N m [29.5 ft-lb]</p> <p>"P" = 19,8 [0.78] 15,0 [0.59]</p>
<p><b>53</b> 9/16-18 UNF (SAE J1926-2)</p>	<p><b>54</b> M10x1.0 (ISO 6149-2)</p>	<p><b>55</b> M12x1.5 (ISO 6149-2)</p>
<p><b>Seal:</b> O-ring <b>Mating geometry:</b> SAE J1926-1 <b>Installation torque:</b> 45 N m [33.2 ft-lb]</p> <p>"P" = 20,8 [0.82] 16,0 [0.63]</p>	<p><b>Seal:</b> O-ring <b>Mating geometry:</b> ISO 6149-2 <b>Installation torque:</b> 20 N m [14.8 ft-lb]</p> <p>"P" = 15,9 [0.63] 11,1 [0.44]</p>	<p><b>Seal:</b> O-ring <b>Mating geometry:</b> ISO 6149-2 <b>Installation torque:</b> 45 N m [33.2 ft-lb]</p> <p>"P" = 18,3 [0.72] 13,5 [0.53]</p>









# Heavy Duty Pressure Transducers

MLH Series, 6 bar to 550 bar | 50 psi to 8000 psi

Issue E

50010132

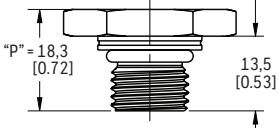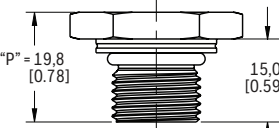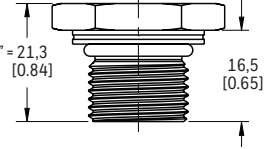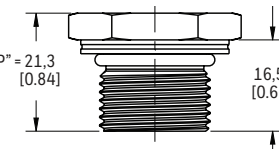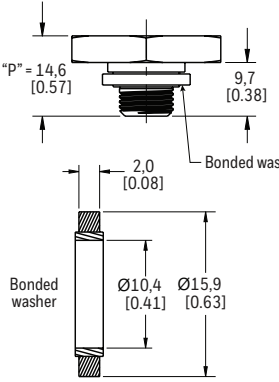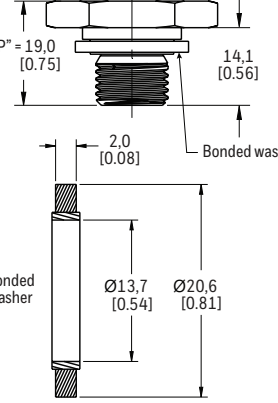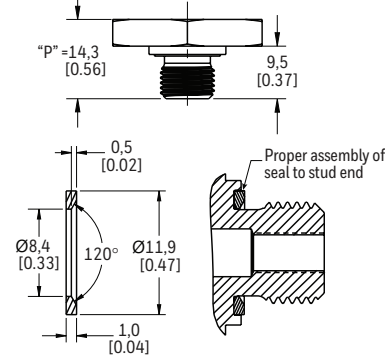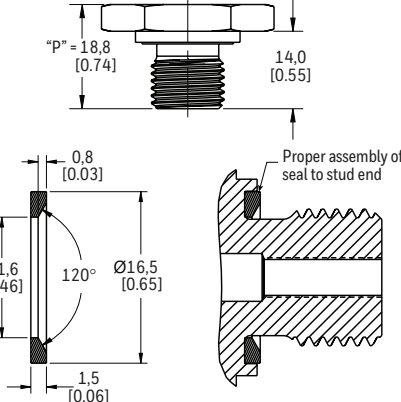Figure 4. Pressure Port Type Mounting Dimensions (continued)

<p><b>56</b> M14x1.5 (ISO 6149-2)</p>	<p><b>57</b> M16x1.5 (ISO 6149-2)</p>	<p><b>58</b> M18x1.5 (ISO 6149-2)</p>
<p><b>Seal<sup>1</sup>:</b> O-ring <b>Mating geometry:</b> ISO 6149-1 <b>Installation torque:</b> 45 N m [33.2 ft-lb]</p> 	<p><b>Seal<sup>1</sup>:</b> O-ring <b>Mating geometry:</b> ISO 6149-1 <b>Installation torque:</b> 55 N m [40.6 ft-lb]</p> 	<p><b>Seal<sup>1</sup>:</b> O-ring <b>Mating geometry:</b> ISO 6149-1 <b>Installation torque:</b> 70 N m [51.6 ft-lb]</p> 
<p><b>59</b> M20x1.5 (ISO 6149-2)</p> <p><b>Seal<sup>1</sup>:</b> O-ring <b>Mating geometry:</b> ISO 6149-1 <b>Installation torque:</b> 80 N m [59.0 ft-lb]</p> 	<p><b>60</b> G1/8-28 (BSPP) DIN 3852-2</p> <p><b>Seal<sup>1</sup>:</b> Bonded washer <b>Mating geometry with bonded washer:</b> DIN 3852-1; 2000-11, large <b>Installation torque:</b> 20 N m [14.8 ft-lb]</p> 	<p><b>61</b> G1/4-19 (BSPP) DIN 3852-2</p> <p><b>Seal<sup>1</sup>:</b> Bonded washer <b>Mating geometry with bonded washer:</b> DIN 3852-1:2000-11, large <b>Installation torque:</b> 50 N m [36.9 ft-lb]</p> 
<p><b>62</b> G1/8-28 (BSPP) ISO 1179-2</p> <p><b>Seal<sup>1</sup>:</b> Elastomeric <b>Mating geometry:</b> ISO 1179-1 <b>Installation torque:</b> 20 N m [14.8 ft-lb]</p> 	<p><b>63</b> G1/4-19 (BSPP) ISO 1179-2</p> <p><b>Seal<sup>1</sup>:</b> Elastomeric <b>Mating geometry:</b> ISO 1179-1 <b>Installation torque:</b> 50 N m [36.9 ft-lb]</p> 	

<sup>1</sup> Seal accessory included with transducer. Seal accessory material and specifications: O-ring (nitrile, durometer 90, temperature range -30°C to 125°C), bonded washer (steel outer ring with nitrile inner ring, temperature range -30°C to 125°C), elastomeric seal (nitrile, temperature range -30°C to 125°C).



## **⚠️ WARNING**

### **PERSONAL INJURY**

DO NOT USE these products as safety or emergency stop devices or in any other application where failure of the product could result in personal injury.

**Failure to comply with these instructions could result in death or serious injury.**

### **Warranty/Remedy**

Honeywell warrants goods of its manufacture as being free of defective materials and faulty workmanship during the applicable warranty period. Honeywell's standard product warranty applies unless agreed to otherwise by Honeywell in writing; please refer to your order acknowledgement or consult your local sales office for specific warranty details. If warranted goods are returned to Honeywell during the period of coverage, Honeywell will repair or replace, at its option, without charge those items that Honeywell, in its sole discretion, finds defective.

**The foregoing is buyer's sole remedy and is in lieu of all other warranties, expressed or implied, including those of merchantability and fitness for a particular purpose. In no event shall Honeywell be liable for consequential, special, or indirect damages.**

While Honeywell may provide application assistance personally, through our literature and the Honeywell web site, it is buyer's sole responsibility to determine the suitability of the product in the application.

Specifications may change without notice. The information we supply is believed to be accurate and reliable as of this writing. However, Honeywell assumes no responsibility for its use.

### **For more information**

Honeywell Advanced Sensing Technologies services its customers through a worldwide network of sales offices and distributors.

For application assistance, current specifications, pricing or the nearest Authorized Distributor, visit [our website](#) or call:

Asia Pacific	+65 6355-2828
Europe	+44 (0) 1698 481481
USA/Canada	+1-800-537-6945

## **Honeywell Advanced Sensing Technologies**

830 East Arapaho Road  
Richardson, TX 75081  
[sps.honeywell.com/ast](http://sps.honeywell.com/ast)

50010132-E-EN | E | 05/21  
© 2021 Honeywell International Inc.

# **Honeywell**