

Please be informed that the data shown in this PDF Document is generated from our Online Catalog. Please find the complete data in the user's documentation. Our General Terms of Use for Downloads are valid (http://download.phoenixcontact.com)



Bus system connector, female, straight, 5-pos., M12, shielded, gold-plated contacts, B-coded, screw connection, metal knurl, cable screw connection Pg9

#### Why buy this product

- Safe use in the field, thanks to a high degree of protection
- Screw connection: proven connection technology for a large selection of different conductors
- Reliable signal transmission 360° shielding in environments with electromagnetic interference



#### Key commercial data

Packing unit	1 pc
GTIN	4 017918 900434
Weight per Piece (excluding packing)	47.94 g
Custom tariff number	85366990
Country of origin	Germany

## Technical data

#### **Dimensions**

External diameter	6 mm 8.5 mm
Stripping length of the sheath	35 mm
Stripping length of the individual wire	5 mm

#### Ambient conditions

Ambient temperature (operation)	-40 °C 85 °C (Plug / socket)
Degree of protection	IP67

#### General

Rated current at 40°C	4 A
Rated voltage	60 V



## Technical data

#### General

Number of positions	5	
Contact resistance	$\leq 3 \text{ m}\Omega$	
Insulation resistance	≥ 100 MΩ	
Coding	B - inverse	
Standards/regulations	M12 connector IEC 61076-2-101	
Status display	No	
Surge voltage category	II	
Pollution degree	3	
Connection method	Screw connection	
Conductor cross section	0.25 mm² 0.75 mm²	
AWG conductor cross section	24 18	
Insertion/withdrawal cycles	≥ 100	
Torque	0.4 Nm (M12 knurl)	
	0.2 Nm (Screw terminal blocks)	
	0.8 Nm 1 Nm (Pressure screw for outer cable diameter 4 mm 8 mm)	
	1 Nm 1.4 Nm (Pressure screw for outer cable diameter 8 mm 12 mm)	
Tightening torque	Screw plug insert with sleeve housing as far it will go	
Assembly instructions	The wires can be connected both with ferrules and without ferrules	

#### Material

Inflammability class according to UL 94	НВ
Contact material	CuSn
Contact surface material	Au
Contact carrier material	PA 66
Material of grip body	Zinc die-cast, nickel-plated
Material, knurls	Nickel-plated brass
Sealing material	NBR

## Classifications

#### eCl@ss

eCl@ss 4.0	27140815
eCl@ss 4.1	27140815
eCl@ss 5.0	27260701
eCl@ss 5.1	27260701
eCl@ss 6.0	27279221
eCl@ss 7.0	27440104
eCl@ss 8.0	27440104

GOST / GOST / UL Recognized / cUL Recognized / cULus Recognized



# Bus system connector - SACC-M12FSB-5CON-PG9 SH AU - 1507777

## Classifications

**ETIM** 

ETIM		
ETIM 2.0	EC001121	
ETIM 3.0	EC002062	
ETIM 4.0	EC002062	
ETIM 5.0	EC002062	
UNSPSC		
UNSPSC 6.01	31251501	
UNSPSC 7.0901	31251501	
UNSPSC 11	31251501	
UNSPSC 12.01	31251501	
UNSPSC 13.2	31251501	
Approvals		
Approvals		
Approvals		

Ex Approvals

Approvals submitted

Approval details

GOST C	200		
	GOST 🕑		

GOST C		

UL Recognized <b>\$1</b>	
Nominal current IN	4 A
Nominal voltage UN	60 V



#### Approvals

cUL Recognized	
Nominal current IN	4 A
Nominal voltage UN	60 V

cULus Recognized • Sus

#### Accessories

Accessories

Protective cap

Screw plug - PROT-M12 MS-PA-CHAIN - 1430899

M12 sealing cap with fixing band, for sensor cables, for free M12 sockets



#### Screwdriver tools

Tool - SACC BIT M12-D20 - 1208445



Nut for assembling SACC M12 connectors for free assembly, excluding M12 connectors with QUICKON fast connection technology, for 4 mm hexagonal drive

Adapter insert - TSD-M SAC-BIT ADAPTER - 1212600

Adapter bit for TSD-M...torque tools, E6.3-1/4" drive with 4 mm hexagon to accommodate SAC bits

Torque tool



#### Accessories

Torque screwdriver - TSD 04 SAC - 1208429



Torque screwdriver, with preset torque of 0.4 Nm and 4 mm hexagonal drive for M12 connectors

Torque screwdriver - TSD-M 1,2NM - 1212224



Torque screw driver, accuracy as per EN ISO 6789 standard, adjustable from 0.3 - 1.2 Nm

## **Drawings**

#### Schematic diagram




Schematic diagram



Cable connection side M12 (screw connection)

Pin assignment M12 socket, 5-pos., B-coded, female side


#### Dimensioned drawing




M12 x 1 socket, straight, shielded



#### Functional drawing

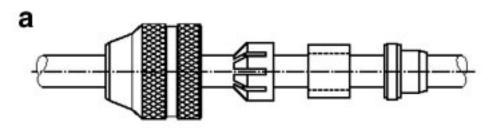

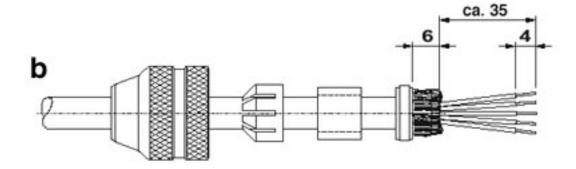

Assembly steps for M12 male/female plug and conductor a = Slide on parts

b= Strip conductor, widen shield and lay around the shielding ring, cut off projecting mesh. Slide cores through the housing. Mount shielding ring, gasket and clamping cage. Tighten pressure screw to fix the cable. Screw down cores. Mount male/female part. Tighten pressure screw.

Phoenix Contact 2014 © - all rights reserved http://www.phoenixcontact.com