



MOLDEX® DISPOSABLE RESPIRATORS



APPLICATIONS:

▲ WARNING TO USER:

Follow all instructions and warnings on the use of this respirator and wear during all times of exposure. Failure to do so will reduce respirator effectiveness, wearer protection and may result in sickness or death.

Before use, the user must first be trained by the employer in proper respirator use, in accordance with applicable safety and health standards, for the contaminant and exposure level in the assigned work area.

The particulates and other contaminants which can be dangerous to your health include those which you cannot see, taste, or smell.

Our industrial respirators have not been sold with warnings or use instructions for personnel involved in healthcare or related situations, where there may be the possibility of contact with disease or biological hazards. If you are considering such uses, first call the Moldex Technical Service Dept., 310/837-6500 ext. 512/550 or 800/421-0668 ext. 512/550.

HOW DO I CHOOSE AN APPROPRIATE FILTER?

Respirators certified under 42CFR 84 are divided into filter types and efficiency levels.

An N95 Would be 95% efficient in environments where no oils are present.

Filter Types:	<ul style="list-style-type: none"> • N-Series: • Not for oil • 95% 	<ul style="list-style-type: none"> • R-Series: • Resistant to oil • 99% 	<ul style="list-style-type: none"> • P-Series: • Oil proof • 100% (99.97%)
----------------------	--	---	--

Efficiency classes:

RESPIRATORS — COMMON APPLICATIONS

Lightweight, cost effective, comfortable protection.

N95 and R95 Series

Grinding, Torch Cutting, Sanding, Metal Pouring, Sweeping, Metal Working, Bagging, Foundries, Stone Quarrying, Agriculture, Metal Machining, Construction Sites, Cement, Ceramics Manufacturing, Underground Mining, Timber/Lumber Mills, Polishing, Buffing, Lime, Poultry, Textiles, Welding, Brazing, Soldering.

N95 and R95 Plus Nuisance Levels of Ozone and Organic Vapors

Welding, Arc Cutting, Foundry Operations, Brazing, Plasma Spraying, Laser Beam Cutting/Welding, Laboratory Settings, Agriculture, Petrochemical Manufacturing, Rendering Plants, Auto Repair, Mining Operations, Waste Disposal.

N95 and R95 Plus Nuisance Levels of Acid Gas Irritants

Aluminum Smelting, Glass Etching, Electroplating, Fiberglass Manufacturing, Paper Processing, Chemical Processing, Brewing Operations, Fertilizer Production.

N99 Series

Welding, Soldering, Brazing, Metal Working, Grinding, Sanding, Cement Work, Metal Pouring, Underground Mining, Textile Manufacturing.

N100/P100 Series

Metal Working, Grinding, Sanding, Sweeping, Bagging, Foundries, Pharmaceutical Operations, Power Plants, Environments where an OSHA substance specific standard applies (e.g., lead, cadmium, arsenic, MDA).

USE AGAINST (N95 MODELS):

1. Particulate aerosols free of oil.
2. For 2400N95, 2800/1N95, and M2800/1N95 only, Nuisance levels (less than OSHA Permissible Exposure Limits) of Organic Vapor Odors and/or Ozone.
3. For 2500N95 only, nuisance levels (less than OSHA Permissible Exposure Limits) of Acid Gas Irritants.

USE AGAINST (R95 MODELS):

1. Oil and non-oil particulate aerosols.
2. For 2840/1R95 only, nuisance levels (less than OSHA Permissible Exposure Limits) of Organic Vapor Odors and/or Ozone.
3. For 2940/1R95 only, nuisance levels (less than OSHA Permissible Exposure Limits) of Acid Gas Irritants.

DO NOT USE AGAINST (N95, N99 & N100 MODELS):

1. Concentrations of contaminants which are unknown, or are immediately dangerous to life or health.
2. Concentrations of particulates which exceed the maximum use concentration or 10 times the OSHA Permissible Exposure Limit, whichever is lower.
3. Gases, vapors, asbestos, paint spray, sandblasting or particulate materials which generate harmful vapors.
4. Oil-based mists.

DO NOT USE AGAINST (R95 & P100 MODELS):

1. Concentrations of contaminants which are unknown or are immediately dangerous to life or health.
2. Concentrations of particulates which exceed the maximum use concentration or 10 times the OSHA Permissible Exposure Limit, whichever is lower.
3. Gases, vapors, asbestos, paint spray, sandblasting or particulate materials which generate harmful vapors. These respirators are NOT approved for any vapors or gases, so when 2840/1R95 is used against Organic Vapor Odors and/or Ozone or 2940/1R95 is used against Acid Gas Irritants, do not exceed the OSHA Permissible Exposure Limit.
4. Oil-based mists for longer than 8 hours after first use.

RESTRICTIONS (N95, N99 & N100 MODELS):

1. This respirator does not supply oxygen and must not be used in atmospheres containing less than 19.5% oxygen.
2. Do not remain in contaminated area if any physical distress occurs, for example breathing difficulty, dizziness or nausea.

3. Leave contaminated area and replace respirator if it is damaged, distorted, a proper fit can not be obtained or breathing becomes difficult.
4. Inspect filter media and staple area prior to each use for tears and damage. Staple perforations do not effect NIOSH approval.
5. Do not alter, modify, or abuse this respirator.
6. Store unused respirators in box in a clean, dry, non-contaminated area.
7. Dispose of respirator according to your employer's policy and local regulations.
8. Dispose no later than thirty days after first use.
9. Use respirator before the "use by" expiration date printed on box or bag.
10. If used for welding, wear appropriate eye and face protection.

RESTRICTIONS (R95 & P100 MODELS):

1. This respirator does not supply oxygen and must not be used in atmospheres containing less than 19.5% oxygen.
2. Do not remain in contaminated area if any physical distress occurs, for example breathing difficulty, dizziness or nausea.
3. Leave contaminated area and replace respirator if it is damaged, distorted, a proper fit can not be obtained or breathing becomes difficult.
4. Inspect filter media and staple area prior to each use for tears and damage. Staple perforations do not effect NIOSH approval.
5. Do not alter, modify, or abuse this respirator.
6. Store unused respirators in in box/bag in a clean, dry, non-contaminated area.
7. Dispose of respirator according to your employer's policy and local regulations.
8. Where oil mists are present dispose no later than 8 hours after first use. Where non-oil particulates only are present, dispose no later than 30 days after first use.
9. Use respirator before the "use by" expiration date printed on box or bag.
10. If used for welding, wear appropriate eye and face protection.

ADDITIONAL INFORMATION FOR HEALTHCARE PARTICULATE RESPIRATOR SURGICAL MASKS:

DESCRIPTION

The Moldex healthcare particulate respirator surgical mask models are designed to help provide respiratory protection for the wearer. This product has been tested¹ and certified by NIOSH as an N95 respirator and as having a filter efficiency level of 95% or greater against particulate aerosols free of oil. It is fluid resistant²; disposable and may be worn in surgery or throughout the hospital. These models do not contain any components made from natural rubber latex.

INTENDED USE

The various models of Moldex type N95 Healthcare Particulate Respirator and Surgical Masks meet CDC Guidelines for TB. Exposure Control within healthcare facilities. These devices are also intended to be worn by healthcare personnel during surgical procedures to protect both the patient and healthcare personnel from the transfer of microorganisms, body fluids and particulate material.

CONTRADICTIONS

1. Not for use with beards, or other facial hair that prevents direct contact between the face and sealing surface of the respirator.
2. Eyewear must not prevent direct contact between the face and sealing surface of the respirator.
3. Not to be used on children.

¹ Tested in accordance with NIOSH 42 CFR 84.

² Passed ASTM F 1862 @ 160mm Hg

Non-latex straps are used in the headbands of these respirators. However, individuals highly sensitive to natural rubber latex may have an allergic reaction.

SUPPLEMENTAL HAZARD WARNINGS FOR MOLDEX PARTICULATE RESPIRATORS

These are **Warnings and Limitations** that all users must be made aware of in addition to all warnings and other information on the outside of the Moldex respirator packaging or other published related information. **You must read and comply with these Warnings and Limitations at all times** and if your employer has determined that it is appropriate to use this respirator.

Proper use of this respirator may reduce but will not eliminate the risk of illness or death from exposure to some Chemical, Biological, Radiological, or Nuclear (CBRN) hazards. CBRN hazards include, but are not limited to, bacteria, toxins, and viruses that can cause death, serious bodily injury or disfigurement. The long-range and short-range risks of CBRN hazards and the amount and manner of exposure that may produce such risks remain to a great extent unknown. Use of this respirator must be in accordance with the Centers for Disease Control (CDC) Health Advisories or any other Local, State or Federal recommendations for use of respirators against specific CBRN hazards. This respirator should not be used for many CBRN hazards.

There are more efficient models of respirators with a higher level of protection available from Moldex and other manufacturers. It is up to the employer, and not Moldex, to determine if a respirator should be worn and if so, which type, size, level of protection, and model.

BACKGROUND

The National Institute for Occupational Safety and Health (NIOSH), a branch of the CDC and a U.S. Government agency, is responsible for testing and certifying respirators for protection against hazardous industrial contaminants. Procedures for selecting and using proper respiratory protection are regulated by various governmental

agencies, such as the Occupational Safety and Health Administration (OSHA). NIOSH tests and certifies certain respirators for use against chemical warfare agents, biological warfare agents or biohazards and provides advisory information for somebiohazards, but OSHA and other government agencies have not set any exposure standards for these agents or biohazards, in general.

Moldex does not make recommendations for any type of respirator to be used against CBRN hazards for workers or the general public.

▲ WARNINGS FOR ALL USERS:

- **This respirator must only be used for substances having Permissible Exposure Limits (PELs) and only where deemed appropriate by your employer.**
- **This respirator must be fit tested. If you cannot obtain a proper fit, do not use the respirator and do not enter the risk area.**
- **This respirator is not for use with beards or other facial hair that prevents direct contact between the face and sealing surface of the respirator.**
- **Moldex respirators, when properly fitted and used as part of a comprehensive respiratory protection program, may reduce wearer exposure to some airborne hazards, but not all.**
- **In the event of a sudden or unexpected CBRN hazard release, you may use this respirator for escape only if you have not been provided with a more appropriate respirator for this type of situation. Do not remove the mask from the face until you have left the contaminated area.**
- **Do not reuse or store for reuse or hang around neck unless your employer specifically authorizes reuse.**
- **Dispose of respirator as a hazardous waste in accordance with your employer's directions.**
- **Use other personal protective equipment, as directed by your employer. Where appropriate use protective gloves when handling or removing respirator and dispose of respirator and then gloves in accordance with your employer's directions.**
- **If CDC or other Local, State or Federal agency issues new or revised guidelines for respirator use against specific hazards, users must strictly comply.**

▲ WARNINGS FOR USE OF PARTICULATE RESPIRATORS AGAINST TB:

OSHA and CDC have recommended the use of any of the particulate respirators approved under 42CFR84 as a means of providing help in complying with a program designed to reduce occupational exposure to tuberculosis.

The level of effectiveness of respiratory protection from tuberculosis cannot be determined with currently available data. However, proper use of appropriate Moldex respirators in conjunction with a comprehensive respiratory protection program may reduce, but will not eliminate, risk of infection.

- **Be sure to read the Limitations outlined below and strictly follow all Warnings set forth under the WARNINGS FOR ALL USERS.**
- **When using any Moldex respirator, filter replacement and/or disposal must be handled in accordance with your Healthcare Facility's comprehensive respiratory protection program.**

- **If disinfectants are used to sanitize reusable facepieces, you must consult with your Healthcare Facility and run tests to ensure the compatibility of any disinfectant with Moldex reusable facepiece materials. Use of disinfectants could impair the efficiency of the respirator and result in a loss of protection.**

LIMITATIONS

• **Respirators may reduce but do not eliminate wearer exposure to airborne hazards or the risk of contracting any disease or infection. Only use this respirator as part of a comprehensive respiratory protection program. You will receive no respiratory protection if this respirator is not properly fitted and worn. Additionally, potentially hazardous particles, including infectious agents, smaller than the particle sizes used in NIOSH certifications are likely to exist in certain environments. Some published data indicates that these smaller particles may not be filtered out as effectively as the particle sizes used by NIOSH [N Series Count Median Diameter (CMD) 0.075 ± .02µm Geometric Standard Deviation 1.86 (GSD) and R Series CMD 0.185 ± .02µm 1.6 (GSD)] when certifying respirators. It is imperative that you determine the size and potential hazards of the particles that may be present in the environment before selecting appropriate respiratory protection, and that you refer to CDC guidelines when selecting and using any respirator, particularly in environments where smaller types of particles, such as those referenced above, may be present.**

- **If the respirator comes in contact with blood or fluids, including body fluids, leave contaminated area as soon as possible and discard and replace the respirator.**

- **Moldex respirators must not be used on children.**


For further information on use of respirators contact Moldex at 800-421-0668 or (310) 837-6500 ext. 554, your Employer, or CDC at www.cdc.gov or 800-311-3435 or (404) 498-1515.

FITTING INSTRUCTIONS

2-Strap Disposable Respirators

- Users must follow instructions each time respirator is worn.
- It's the wearer's responsibility to obtain a proper fit.
- To choose the correct Disposable Respirator Series size/shape you must fit test and user seal check.
- If you cannot obtain a proper fit do not enter the contaminated area.
- OSHA regulation 1910.134 (f) requires that the user must be fit tested before being assigned a respirator and annually thereafter.
- Use Moldex Qualitative Fit Test Kit. User must be clean-shaven. Any facial hair, such as beards or long sideburns, may prevent the respirator from fitting properly.
- Eyewear must not interfere with face to facepiece seal.
- Re-fit test when there are any changes to the wearers physical condition that may affect fit.

1 Hold respirator in hand with molded nose contour (narrow end) at finger tips, allowing headstraps to fall below hand.

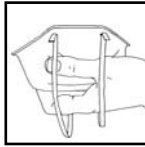

3 Adjust respirator for comfortable fit.



2 Place respirator under chin with molded nose contour (narrow end) up. Nose Cushion must be increased inside respirator. Raise top strap to top back of head. Pull shorter bottom strap over head, below ears, to around neck. **Do not wear with only one strap. When changing from any model/size to another respirator, you must fit test.**



4 Each time user enters contaminated area seal should be fit checked. Cover front of respirator by cupping both hands. **INHALE SHARPLY.** A negative pressure should be felt inside respirator. If any leakage is detected at respirator edges, adjust straps by pulling back along the sides and/or reposition respirator. Repeat until sealed properly, otherwise see your supervisor. Entry into a contaminated area with an improper fit may result in sickness or death.



HandyStrap® Respirators

- Users must follow instructions each time respirator is worn.
- It's the wearer's responsibility to obtain a proper fit.
- To choose the correct HandyStrap Respirator Series size you must fit test and user seal check.
- If you cannot obtain a proper fit do not enter the contaminated area.
- OSHA regulation 1910.134 (f) requires that the user must be fit tested before being assigned a respirator and annually thereafter.
- Use Moldex Qualitative Fit Test Kit. User must be clean-shaven. Any facial hair, such as beards or long sideburns, may prevent the respirator from fitting properly.
- Eyewear must not interfere with face to facepiece seal.
- Re-fit test when there are any changes to the wearers physical condition that may affect fit.

1 Attach buckle behind neck with shell against chest.



3 Each time user enters contaminated area respirator must be seal checked. Cover front of respirator by cupping both hands. **INHALE SHARPLY.** A negative pressure should be felt inside respirator. If any leakage is detected at respirator edges, adjust strap by pulling back along the sides and/or reposition respirator. Repeat until sealed properly, otherwise see your supervisor. Entry into a contaminated area with an improper fit may result in sickness or death.



2 a) Fit mask to face and pull top of strap to crown of head. Nose cushion must be increased inside respirator.



b) **Always use top and bottom part of strap.** Adjust tension for a comfortable fit. **When changing from any model/size to another respirator, you must fit test.**

4 To hang around neck:
a) Undo buckle.
b) Allow strap to fall around neck.
c) Pull mask down to chest.
OR
a) Pull top strap forward away from head.
b) Adjust tension to allow mask to hang freely.




CAUTION: If used against biohazards discard immediately after removing from face and do not hang around neck.


EZ-ON® Series Respirators

- Users must follow instructions each time respirator is worn.
- It's the wearer's responsibility to obtain a proper fit.
- To choose the correct EZ-ON® Series size/shape you must fit test and user seal check.
- If you cannot obtain a proper fit do not enter the contaminated area.
- OSHA regulation 1910.134 (f) requires that the user must be fit tested before being assigned a respirator and annually thereafter.
- Use Moldex Qualitative Fit Test Kit.
- User must be clean-shaven. Any facial hair, such as beards or long sideburns, may prevent the respirator from fitting properly.
- Eyewear must not interfere with face to facepiece seal.
- Re-fit test when there are any changes to the wearers physical condition that may affect fit.

1 Hold respirator in hand with molded nose contour (narrow end) at finger tips, allowing head harness to fall below hand.

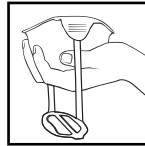


3 Adjust tension by pulling on strap within the head harness to provide a tight and comfortable seal.

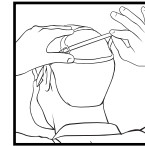

2 Place respirator under chin with molded nose contour (narrow end) up. Nose cushion must be increased inside respirator. Pull head harness to top of head so it rests at the crown.



4 Each time before entering a contaminated area, perform a user seal check. Cover front of respirator by cupping both hands. **INHALE SHARPLY.** A negative pressure should be felt inside respirator. If any leakage is detected at respirator edges, adjust strap by pulling back (on head harness) and/or reposition respirator. Repeat until sealed properly, otherwise see your supervisor. Entry into a contaminated area with an improper fit may result in sickness or death.

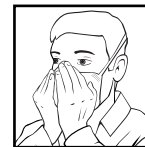

Note:
3200 Series head halo is not adjustable

MOLDEX®
Ideas that wear well.




MOLDEX-METRIC, INC.
10111 W. JEFFERSON BLVD.
CULVER CITY, CALIFORNIA 90232
310-837-6500 FAX 310-837-9563
www.moldex.com e-mail: sales@moldex.com
Moldex, EZ-ON, HandyStrap, Dura-Mesh, Softspun and Ventex are registered trademarks.
9702-773 REV D 11/08
Made in the U.S.A.

Adjustable Strap Respirators 2360P100 & 2315 N99

- Users must follow instructions each time respirator is worn.
- It's the wearer's responsibility to obtain a proper fit.
- If you cannot obtain a proper fit do not enter the contaminated area.
- OSHA regulation 1910.134 (f) requires that the user must be fit tested before being assigned a respirator and annually thereafter.
- Use Moldex Qualitative Fit Test Kit.
- User must be clean-shaven. Any facial hair, such as beards or long sideburns, may prevent the respirator from fitting properly.
- Eyewear must not interfere with face to facepiece seal.
- Re-fit test when there are any changes to the wearers physical condition that may affect fit.

1 Untwist straps. Thread bottom strap through bottom buckle and repeat for top strap. Hold respirator in hand with nose contour (narrow end) at finger tips, allowing headstraps to fall below hand.

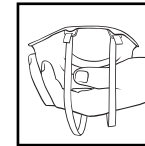


3 Adjust tension on both top and bottom straps to provide a tight and comfortable seal. To tighten, pull ends of straps. To loosen, push open hinge of buckle with thumb and pull on strap.



2 Place respirator under chin with molded nose contour (narrow end) up. Nose cushion must be increased inside respirator. Raise top strap to top back of head. Pull shorter bottom strap over head, below ears, to around neck. **Do not wear with only one strap.**



4 Each time user enters work area, the respirator must be seal checked. Cover front of respirator by cupping both hands. **INHALE SHARPLY.** A negative pressure should be felt inside respirator. If any leakage is detected at respirator edges, adjust straps by pulling back along the sides and/or reposition the respirator. Repeat until sealed properly, otherwise do not enter work area and see your supervisor. Entry into a contaminated area with an improper fit may result in sickness or death.

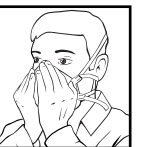

TECHNICAL HELP LINE

For technical assistance call Moldex Technical Service Department 310-837-6500, ext. 512/550 or 800-421-0668, ext. 512/550.

LIMITED WARRANTY IMPORTANT NOTICE TO PURCHASER

This limited warranty is made in lieu of the warranties of merchantability, fitness for particular purposes and all other warranties, express or implied. There are no other warranties which extend beyond the description on the face hereof. The physical standards and specifications of Moldex will be met by products sold. **Exclusive Remedies:** damages for the breach of this limited warranty are limited to the replacement of such quantity of Moldex products proved to be defectively manufactured. Except as provided above, Moldex shall not be liable or responsible for any loss, damage, or liability, direct, indirect, incidental, special, or consequential, arising out of sale, use, or misuse, or the inability to use products by the user.