

Class 1

RJ45 Jack with Integrated Magnetics

1. INTRODUCTION

This specification covers the requirements for application of RJ45 Jack with integrated Magnetics (Non-POE) designed to be mounted to a Printed Circuit Board (PCB). The Jacks are available in ganged type 1x2 configuration in 20, 28 positions with 2 contacts, shielded designs to accommodate specific application requirements. This specification pertains to all shielded jacks with right-angled (R/A) orientation, with LED or light pipe.

When corresponding with TE Personnel, use the terminology provided on this specification to help facilitate assistance. Basic terms and features of components are provided in Figure 1

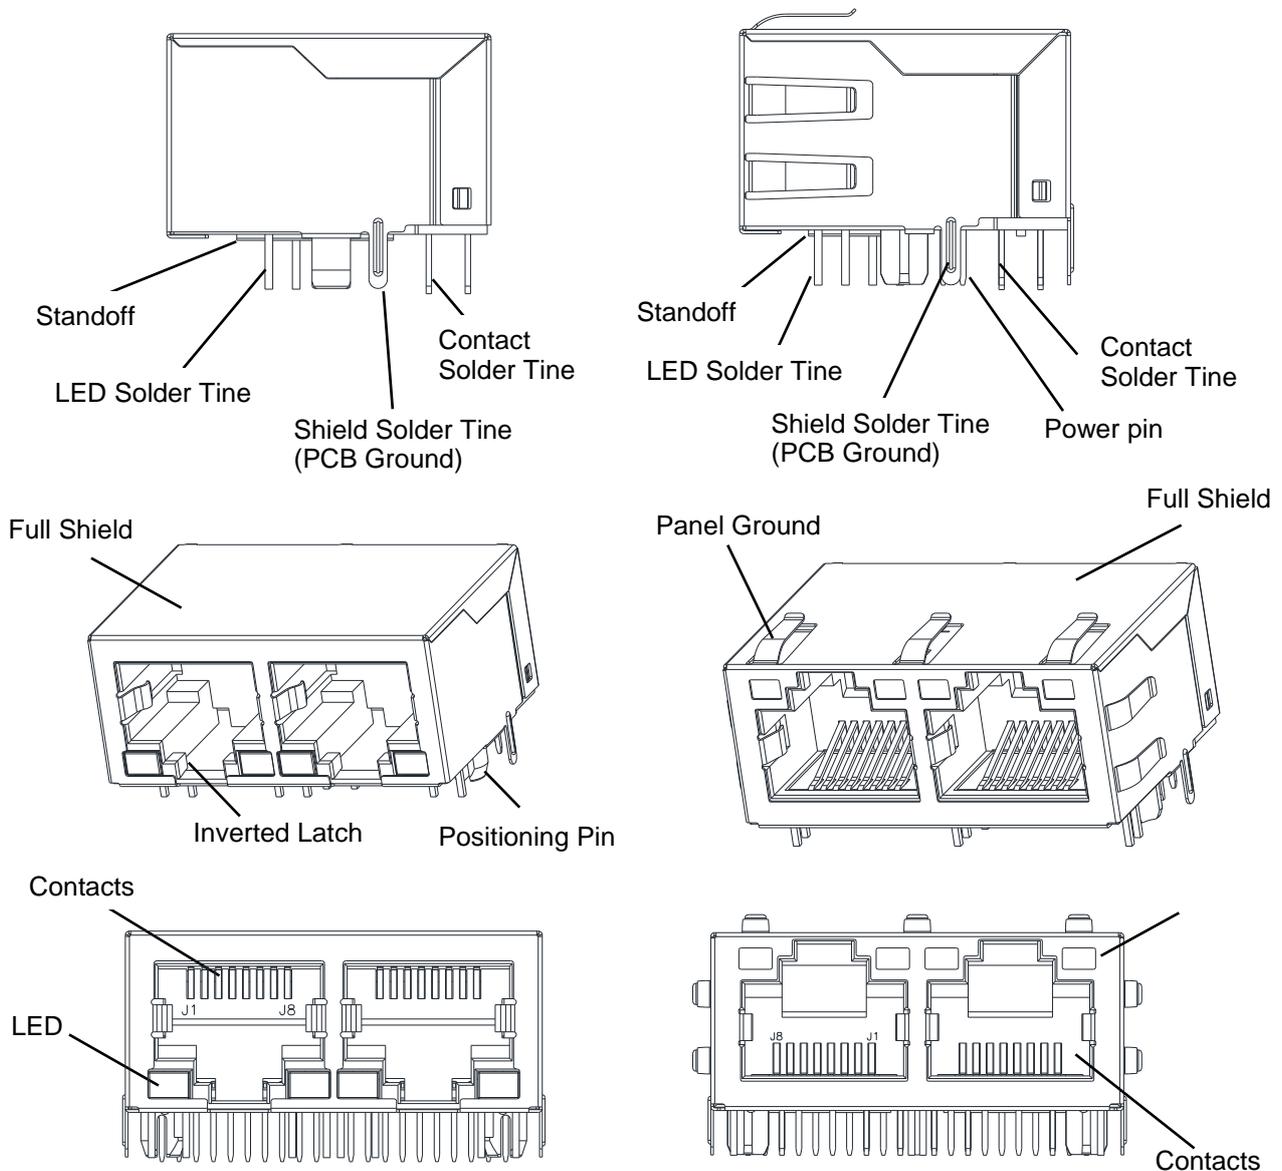


Figure 1: Basic terms and features of components

## 2. REFERENCE MATERIAL

### 2.1. Customer Assistance

Reference Base Numbers 2497288-1/2497289-1/2497290-1/249291-1/249292-1 identify the PCB mounted RJ45 jacks with integrated magnetics. These numbers are used in a service network of customer service to access tooling and product application information. This service is provided by your local TE Representative or, after purchase, by calling the Tooling Assistance Center or Product Information number at the bottom of page 1.

### 2.2. Drawings

Customer Drawings for product numbers are available from the service network. The information on the customer drawing takes priority over this specification and any other document supplied by TE.

### 2.3. Product Specifications

Product Specifications 108-161860 covers test and performance requirements.

### 2.4. Soldering specification

Manual 402-40 is available upon request and can be used as a guide to soldering. This manual provides information on various types and characteristics with the commercial designation and flux removal procedures. A checklist is included in the manual as a guide for information on soldering problems.

## 3. REQUIREMENTS

### 3.1. Safety

Do not stack component packages so high that the shipping containers buckle or deform.

### 3.2. Material

The RJ45 Jack with integrated Magnetics housing is made of GLASS FILLED LCP(BLACK). The contacts are made of Phosphor Bronze under plated with nickel and plated with gold. Positioning pins are made of GLASS FILLED LCP(BLACK). The shield is made of brass plated with nickel.

### 3.3. Storage

#### Ultraviolet Light

Prolonged exposure to ultraviolet light may deteriorate the chemical composition used in the RJ45 Jack with integrated Magnetics material.

#### Shelf Life

RJ45 Jack with integrated Magnetics should remain in the shipping containers until ready for use to prevent damage. The products should be used on a first in, first out basis to avoid storage contamination that could adversely affect signal transmissions and degrade shield appearance.

#### Chemical Exposure

Do not store RJ45 Jack with integrated Magnetics near any chemicals listed below, as they may cause stress corrosion cracking in the components.

Alkalis    Ammonia    Citrates    Phosphates    Citrates    Sulphur Compounds  
 Amines    Carbonates    Nitrites    Sulphur Nitrites    Tartrates

#### Soldering ability over time

To ensure the good solderability of RJ45 Jack with magnetics, the conditions below should be followed:

Table 1: Storage time and conditions

Packaging type	Condition	Maximal storage time
Tray	Original and unopened package, at temperature ≤ 30°C	1 year
Reel		

If storage time exceeds one year, a complete quality check on function & mechanical before parts can be used.

### 3.4. Circuitry and pin description

The PHY chip to which the RJ45 jack with integrated magnetics is connected to has either a current-mode line driver or a voltage-mode line driver. This affects the choice of circuitry that the RJ45 jack with integrated magnetics requires. For a current-mode line driver the center tap of the transformer on the PHY side is connected to a power source to supply current to the PHY, see Figure 2. For a voltage-mode line driver such an external power source is not needed. Here the left center tap of the transformer is only connected via a capacitor to the system ground as shown in Figure 3.

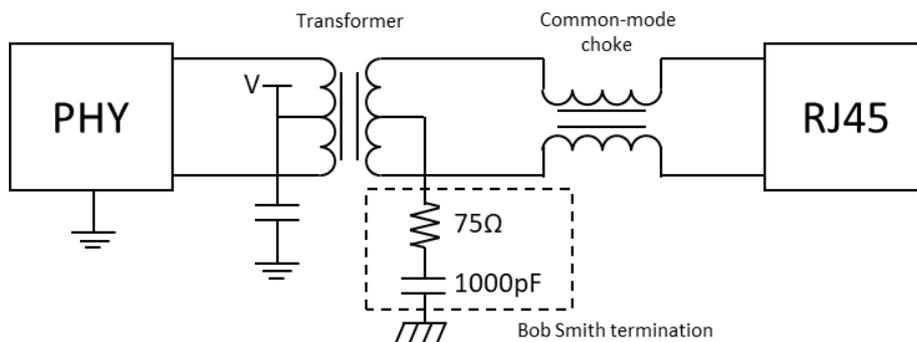


Figure 2: Current-mode driven magnetics (Non POE)

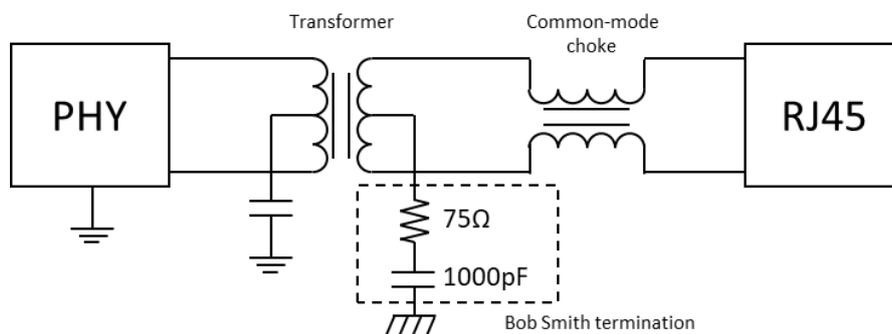


Figure 3: Voltage-mode driven magnetics (Non POE)

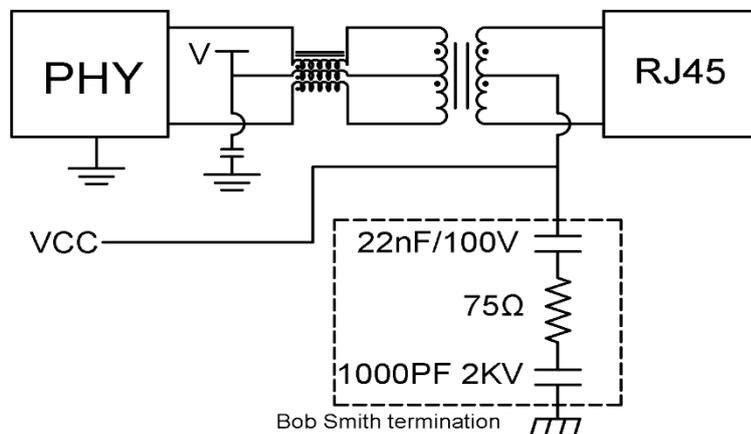


Figure 4: Current-mode driven magnetics (With POE)

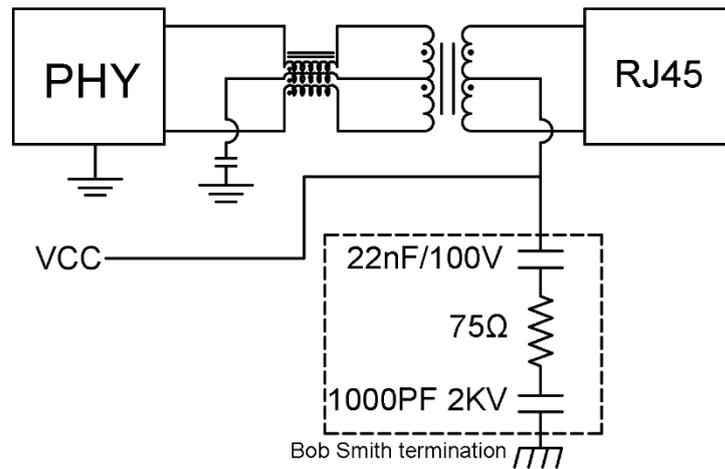


Figure 5: Voltage-mode driven magnetics (With POE)

The center tap on the left side of the transformer ground is connected to the system ground and the ground connection on the right side of the transformer is connected to the shield ground. This connection to the shield is sometimes made inside the RJ45 jack with integrated magnetics.

On the schematic of the product drawings the connections are numbered on one side with the prefix P and on the other side with the prefix J. The prefix P refers to the PHY side. So, for example, if an RJ45 jack with integrated magnetics that has 10 contact pins, the numbering goes from P1 to P10. Note that the functionality of the connections with prefix P can differ between different RJ45 jacks with integrated magnetics. This depends on the used electrical circuit diagram inside the RJ45 jack, which can be found on the product drawing. The prefix J refers to the jack side and represent the eight contacts of the jack numbered from J1 to J8 as provided in Figure .

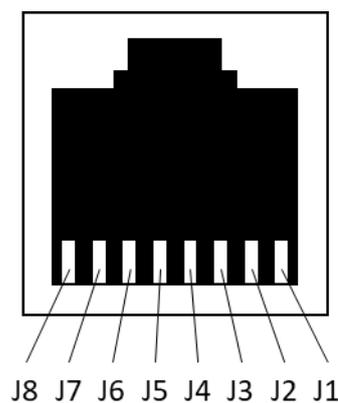


Figure 6: Pinout of RJ45 jack

Ethernet transmits its data over signal pairs. Two signal pairs are used for 10/100BASE-T Ethernet, having 10 or 100Mbps data rate. Four signal pairs are used for 1000BASE-T, 2.5G BASE-T, 5G BASE-T and 10G BASE-T Ethernet, having 1Gbps, 2.5Gbps, 5Gbps and 10Gbps data rate. Each signal pair and its relation to the pinout of Figure are given in Table 2. Typically, a variety of labels are used for each connection of the signal pairs on the PHY and RJ45 jack side. One possible set of labels are mentioned in Table 2 as well.

Table 2: Signal pair definition

Signal pair	Pinout RJ45 jack	10/100BASE-T		1000BASE-T, 2.5G BASE-T, 5G BASE-T, 10G BASE-T	
		PHY side	Jack side	PHY side	Jack side
1	J1	TD+	TX+	TD1+	TX1+
	J2	TD-	TX-	TD1-	TX1-
2	J3	RD+	RX+	TD2+	TX2+
	J6	RD-	RX-	TD2-	TX2-
3	J4	Not used	Not used	TD3+	TX3+
	J5	Not used	Not used	TD3-	TX3-
4	J7	Not used	Not used	TD4+	TX4+
	J8	Not used	Not used	TD4-	TX4-

### 3.5. PCB Layout

The solder tine hole layout for 20, 28, positions RJ45 jacks is typical for all jacks with comparable positions. The mounting hole location will depend on the number of ports and contact positions. The PCB layout views shown represent the component side of the PCB.

The mounting holes must be placed in accordance with the customer drawing to ensure proper alignment and optimum continuity for circuits after soldering. The holes must be drilled to specific dimensions to prevent stubbing during placement of the RJ45 Jack with integrated Magnetics on the PCB.

#### A. 1x2 shielded Jack with standard Latch (Tab down without POE)

The hole patterns that apply to all 1x2 jacks with standard Latch are provided in the following figures.

*Component Side of PC Board*


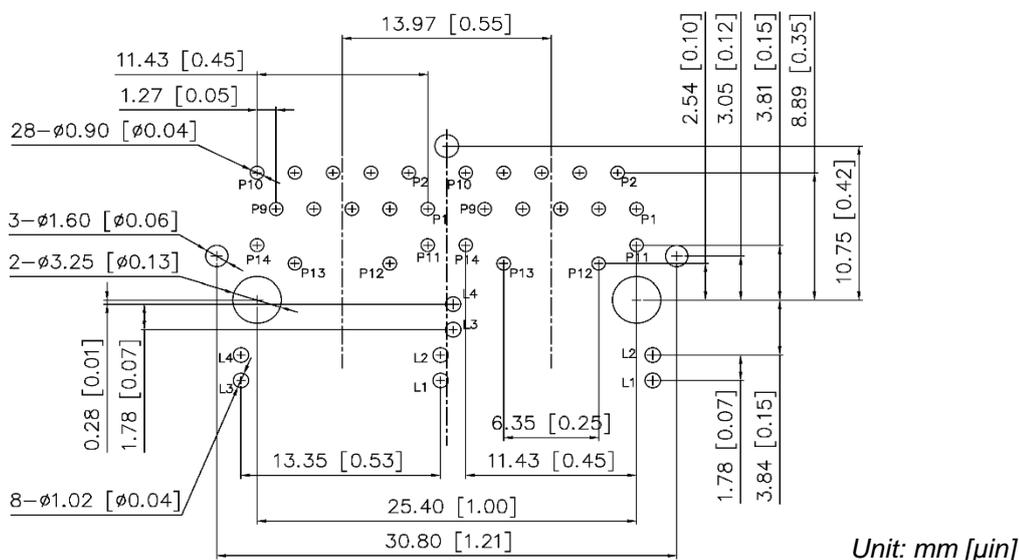


Figure 7: 20 Position Jack, Tab down with LED (2497288-1) PCB Layout

**B. 1x2 shielded Jack with Inverted & Standard Latch (Tab up with POE)**

The hole patterns that apply to all 2x1 jacks with Inverted (Top) & Standard (Bottom) Latch are provided in the following figures.

*Component Side of PC Board*

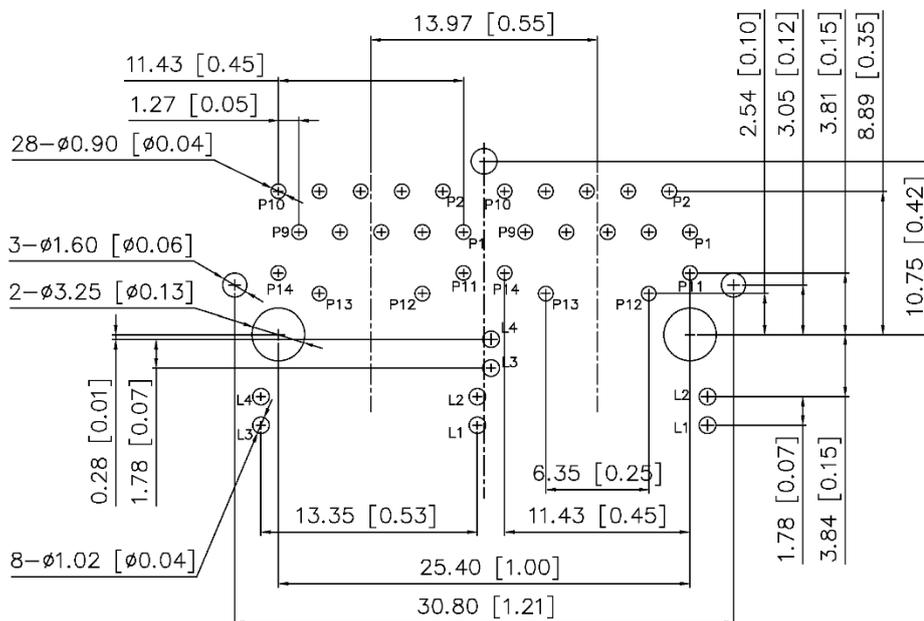

*Unit: mm [ $\mu$ in]*

Figure 8: 28 Position Jack, Tab up with LED&POE (2492789-1, 2492790-1, 2492791-1, 2492792-1) PCB Layout

**3.6. PCB Contact Tine Holes**

Plated through holes should be used for contact solder tines and, when applicable, shield solder tines. The drilled hole size, plating types, and plating thickness are dependent on your application requirements. The finished hole size must be as stated to provide unrestricted insertion, proper retention in the PCB, and to ensure adequate application of solder to the tines. See Figure 9.

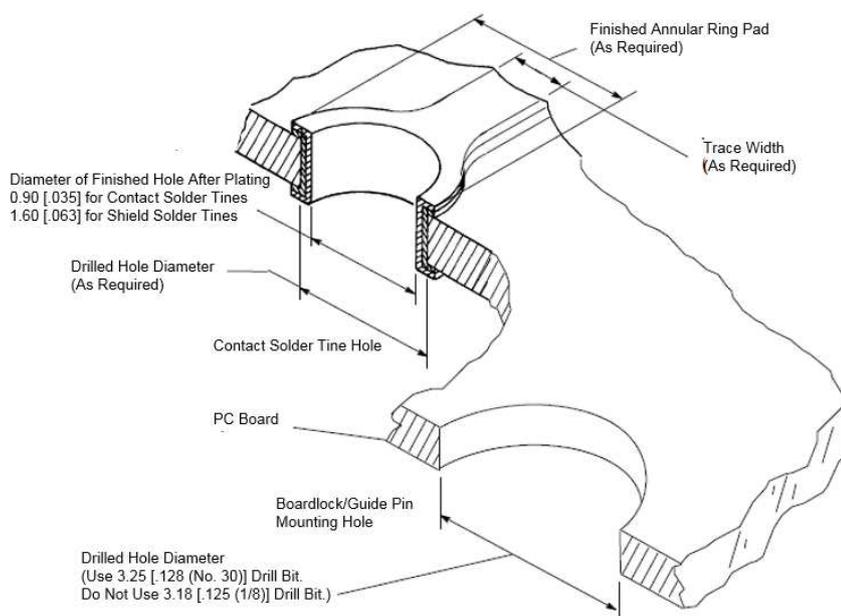


Figure 9: Contact Tine Holes dimensions in PCB

### 3.7. Jack placement



The connector should be handled only by the housing to avoid deformation, contamination, or other damage to the contact solder tines and, where applicable, shield solder tines

#### A. Alignment

The RJ45 Jack with integrated Magnetics shall be flush and evenly seated on the PCB. A hold-down may be used to hold the jack in place during the soldering process.

#### B. Position


Determine which hole in the PCB is to receive the number one contact tine, then orient the jack so the number one solder tine is aligned with the hole. Insert all solder tines into the board, then press on the top of the jack until it seats on the PCB.

### 3.8. Shielding

Shielded RJ45 Jack with integrated Magnetics features brass or stainless shells which provide continuity for EMC (Electromagnetic Compatibility) applications. When mated with corresponding shielded RJ45 plugs, shielding and grounding continuity are achieved. When the shield solder tines are soldered to the PCB they provide electrical continuity to any ground path on the PCB and, where applicable, panel ground tabs on the shield provide electrical continuity to any ground path through the equipment panel.

### 3.9. Panel Cutout

After the modular jack is secured to the PCB, the modular jack can be positioned in a cutout in a panel. Dimensions for recommended panel cutout are shown in following figures.

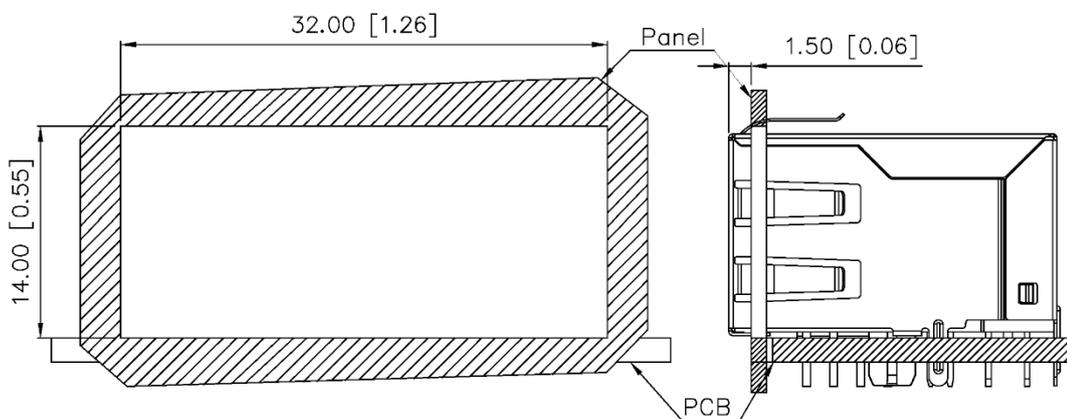

Unit: mm [ $\mu$ in]

Figure 10: 20/28 Position Jack, Tab up & Tab down with LED (2492788-1, 2492789-1, 2492790-1, 2492791-12492792-1) panel cutout

## Soldering Guidelines

RJ45 Jack with integrated Magnetics can be soldered using wave or equivalent soldering techniques according to IPC/JEDEC J-STD-020D for PB-free soldering, unless specified differently on the drawing. The temperatures and exposure time shall be within the ranges specified in Table 3.

Table 3: Temperature and exposure time

SOLDERING PROCESS	TEMPERATURE		TIME (At Max Temp)
	CELSIUS	FAHRENHEIT	
Wave Soldering	260	500	10 Seconds



The connector should not be cleaned by immersion in liquid or by an aqueous spray-in-air process. The manual removal of the flux or the use of no-clean flux is recommended.

### 3.10. Checking Installed Jack

The Jack must be seated on the PCB as shown in figure 11.

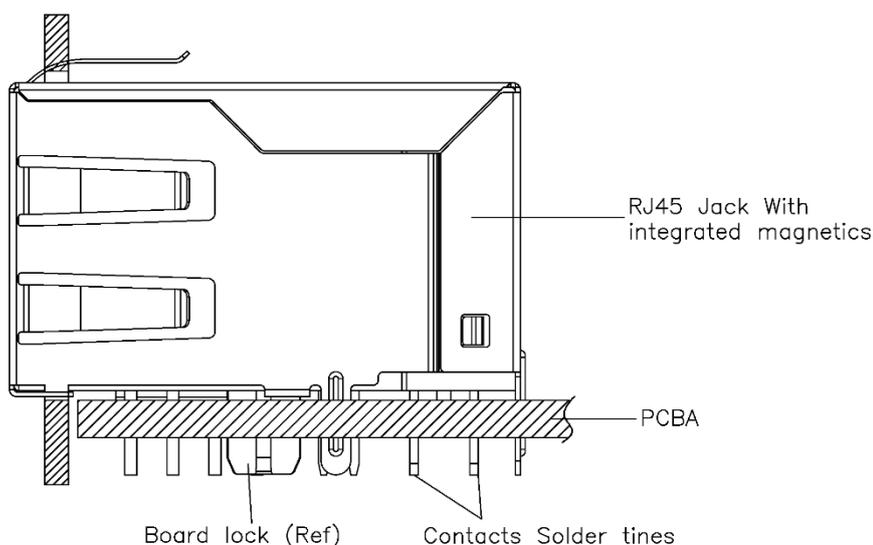


Figure 11: RJ45 Jack with integrated magnetics installed on PCB

### 3.11. Repair/Removal

If the jack should become damaged, it must be replaced. It may be removed from the PCB by



When repairing or replacing a RJ45 Jack with integrated Magnetics, be careful not to damage other PCB components during the desoldering process.

normal desoldering methods and replaced with a new jack.

**4. QUALITY**


RJ45 Jack are recognized by Underwriters Laboratories Incorporated (UL) in File E535135

**5. TOOLING**

No special tooling is required for hand placement of RJ45 Jack with magnetics onto a PCB. However, a backup support that provides relief for protruding components is needed to prevent deformation of contact solder tines and, when applicable, shield solder tines.

**6. VISUAL AID**

Figure 12 shows typical installation applications of RJ45 Jack with integrated magnetics and should be used by production personnel to ensure a correctly applied product. Applications which DO NOT appear correct should be inspected using the information in the preceding pages of this specification.

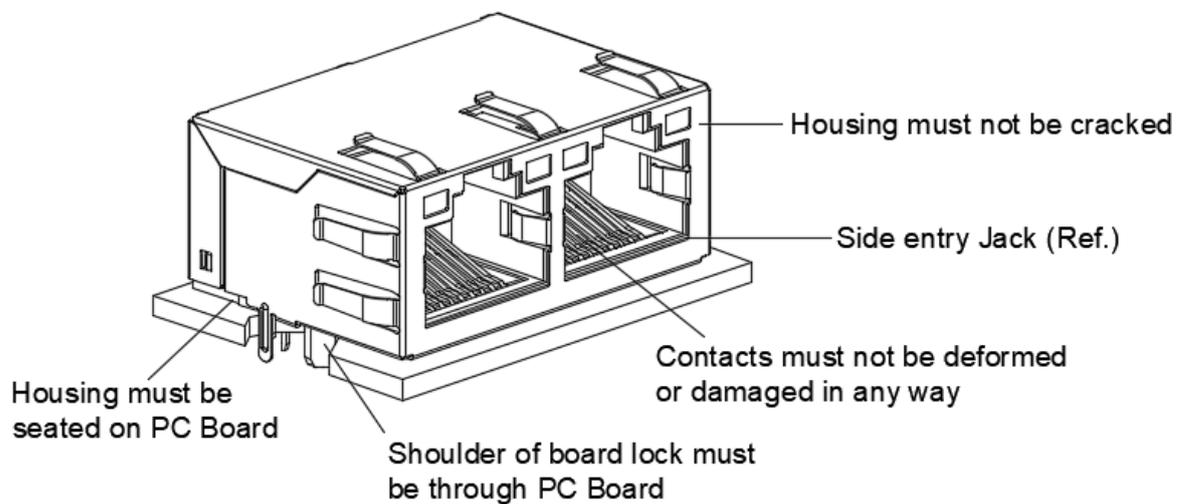

*Figure 12: Visual aid*

**8. APPENDIX**

**8.1. List of figures**

*Figure 1: Basic terms and features of components*..... 1  
*Figure 2: Current-mode driven magnetics Non POE* ..... 3  
*Figure 3: Voltage-mode driven magnetics Non POE*..... 3  
*Figure 4: Current-mode driven magnetics With POE*..... 3  
*Figure 5: Voltage-mode driven magnetics With POE*..... 4  
*Figure 6: Pinout of RJ45 jack* ..... 4  
*Figure 7: 20 Position Jack, Tab down with LED (2492788-1) PCB Layout*..... 5  
*Figure 8: 28 Position Jack, Tab up with LED (2492789-1, 2492790-1, 2492791-1,2492792-1) PCB Layout* t ..... 6  
*Figure 9: Contact Tine Holes dimensions in PCB* ..... 6  
*Figure 10: 20/ 28 Position Jack, Tab up &Tab down with LED (2492788-1, 2492789-1,2492790-1,2492791-12492792-1) panel cutout Jack, Tab up with LED* ..... 7  
*Figure 11: RJ45 Jack with integrated magnetics installed on PCB*..... 8  
*Figure 12: Visual aid*..... 9

**8.2. List of tables**

Table 1: Storage time and conditions ..... 2  
 Table 2: Signal pair definition ..... 5  
 Table 3: Temperature and exposure time ..... 8