

Features

- Accuracy <0.2% FS• Internal
- Ranges from -1 to 1000 bar
- 27000 data records per test
- Space for 10 tests max 48h each
- Recording rate up 100ms
- Back-lit display with bar graph & min/max
- Selectable display of temperature
- 3 x 1.5Vdc AAA battery supply
- Compact and Rugged IP67
- 270° Rotatable Display

RS PRO Pressure Gauge

RS Stock No.: 315-682, 315-684, 315-685, 315-687, 315-688, 315-689



RS PRO is the own brand of RS. The RS PRO Seal of Approval is your assurance of professional quality, a guarantee that every part is rigorously tested, inspected, and audited against demanding standards. Making RS PRO the Smart Choice for our customers.



Product Description

This RS PRO series of digital pressure gauges are designed for both stationary and mobile measurement, display and datalogging of pressure.

They can be used as reference pressure gauges to simplify the checking, adjustment and calibration of other pressure measurement devices directly on site.

Excellent protection against dust and moisture is provided by a membrane keypad with rubber buttons and rubber protective shroud.

DEVICE & OPERATION OVERVIEW


- 1 Bar graph display with maximum pointer function, 33 segments
- 2 Actual pressure display, digit height 15 mm
- 3 Unit display / recording series display
- 4 Data logger display, flashes during recording
- 5 Battery status display, 5 segments
- 6 Additional display MIN/MAX value, full scale pressure value or temperature (°C or °F) digit height 8mm
- **7** USB-C connection to PC/laptop for data transfer and software updates
- 8 Control buttons


ON/OFF	Switch device on or off
LIGHT	Backlighting (20s)
MENU	Device settings
UNIT	Select measurement units (see technical data)
ZERO	Zero point correction up to 5% of full scale pressure value
MODE	Show MIN/MAX, Temp (°C or °F) or gauge F.S.
REC	Start or stop data logger
SET	Delete MIN/MAX value or confirm input





Technical drawing

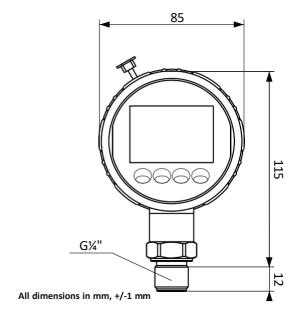

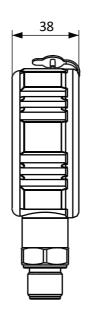



Optional Minimess® Male or Female adaptor to allow for easy hand tight connection / disconnection to Minimess® test points or hoses (max working pressure 630 bar).

Ordering code

Ordering code	Measuring range	Resolution
315-682	-116 bar	1 mbar
315-684	060 bar	10 mbar
315-685	0250 bar	100 mbar
315-687	0400 bar	100 mbar
315-688	0700 bar	100 mbar
315-689	01000 bar	100 mbar

- *-MM after part number for Minimess® 1620 male adaptor fitted
- -MF after part number for Minimess® 1620 female adaptor fitted



RS PRO

Technical data

Pressure ranges	Between -11000 bar
Accuracy ±(% of full scale pressure value)(FS)	0.2%
Pressure units	bar/mbar, kPa/MPa, PSI, kg/cm2, mH2O, inH2O, ATM
Display type	Multifunctional LCD, 4 1/2 digit, with background lighting
Display functions	Bar graph, pressure unit, display filter, MIN/MAX value, Overpressure indicator 110% of full scale pressure value (FS)
Pressure measuring cell	≤ 10 bar piezo resistive, ≥ 20 bar thin film strain gauge
Temperature compensation	050°C
Temperature error	0.005% of full scale pressure value (FS) / K
Measuring rate actual value	10ms
Measuring rate bar graph	50ms
Thread ISO 1179-2	G1⁄4 with NBR gasket, AF27
Process connection material	Stainless steel 1.4404
Medium temperature	-2080 °C
Housing connection	270° axially rotatable
Degree of protection DIN EN 60529	IP67
Dimensions	Ø 90 mm, D=45mm H=120mm with protection cap
Materials	Sensor Body 304L, Measuring Cell 316L
Ambient conditions	050 °C with air humidity ≤85 % r.h.
Weight	357g without 3xAA batteries fitted
Vibration resistance IEC 60068-2-6	5g up to 500Hz
Shock resistance IEC 60068-2-29	25g for 11ms
Auto-off function	Selectable switch-off time 5 minutes
Battery type	3x 1.5 V AAA
Battery operation	1500h
Datalogger max. data sets	27000 per recording series
Datalogger record series	110
Storage rate	0.1. 6.4 s - automatic depending on recording duration
Max. recording duration	48 h
Data set information	time / actual pressure / MIN/MAX value
Digital data transmission	serial USB 2.0 via USB-C port
PC software	Detection as USB data storage device, spreadsheet program (Excel)
File format	.csv
Mobile device software	Compatible with Watchlog Bluetooth iOS and Android apps for display and datalogging
	The factory linearisation is changed via OFFSET and INCREASE.
Linearisation	A special programming adapter is required. Communication between PC/laptop and digital pressure gauge is via TTL level by means of a PC terminal program
Certificate (optional)	UKAS traceable certificate, works test certificate



Datalogger function

- 10 recording series possible.
- 27,000 data sets per recording series.
- Each data record contains time, date, actual pressure, and MIN/MAX value.
- Intelligent automatic measuring intervals mean the time between data-sets (storage rate) is selected automatically depending on the recording duration (see table below).

Recording duration (h)	Storage rate (s)	Maximum data-sets
00.5	0.1	18000
0.51	0.2	18000
12	0.4	18000
24	0.8	18000
48	1.6	18000
816	3.2	18000
1648	6.4	27000

- •A total of 640 MIN/MAX measurements are recorded between two storages with a storage rate of e.g. 6.4 seconds at a measuring rate of 10 ms. Any irregularities occurring due to pressure drop or pressure peaks are detected as MIN/MAX valued and stored in the data set.
- Summary of all MIN/MAX values per record series
- Plug & Play USB connection means no additional drivers or software required.
- Data stored and transferred in CSV (plain text) format so no need for conversion.

 Open directly in spreadsheets or databases (MS Excel, MS Access, Apple Numbers, LibreOffice, OpenOffice, etc).

Security of Operation

- The gauge cannot be accidentally powered down when datalogging function is enabled.
- Non-volatile storage means that recordings are retained if batteries expire.
- Future-proof by transferring software updates via USB-C connection to PC/laptop.
- Recorded data is stored securely so overwriting your results is not possible.

Kit Contents

- 1 Digital datalogging gauge.
- **2** Robust protective plastic carry-case.
- 3 USB data stick for storage of CSV data files.
- 4 USB-C to USB-A connecting cable for data transfer to PC/ laptop and software updates.

